

General Information

Date & Time: 11, Feb, 2026 10:48

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	23,645
Registration No.	NHM1808	Chassis No.	PA1B18F3XP4236751
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



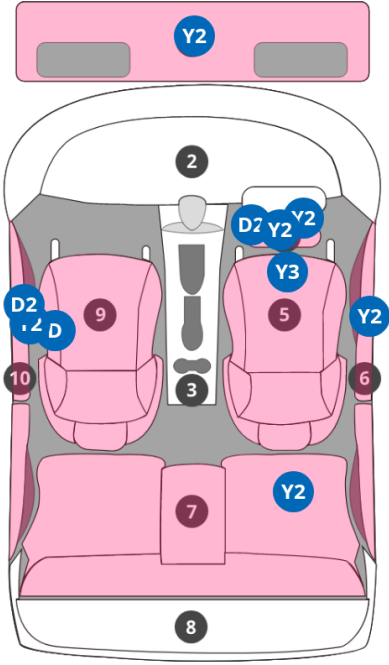
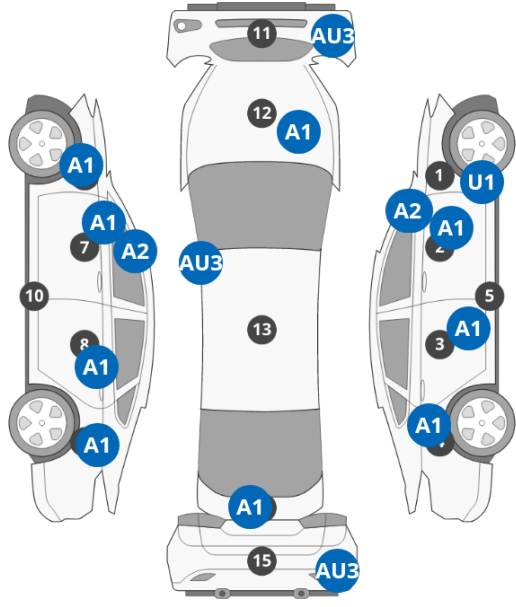
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	106	103	109
2	Boot Lid	105.8	114	93	110
3	Roof	95.6	103	94	90/96
4	Left Front Fender	100.2	99	104	98
5	Left Front Door	101.0	100	99	104
6	Center Panel Left				
7	Left Rear Door	105.7	93	100	124
8	Left Back Panel	111.3	120	105	109
9	Right Front Fender	118.6	166	96	94
10	Right Front Door	96.2	94	99	95
11	Center Panel Right				
12	Right Rear Door	98.0	94	105	96
13	Right Back Panel	100.3	103	99	99

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Mat Other - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Worked - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (R) Mirror - Crack - Damaged / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light</p>