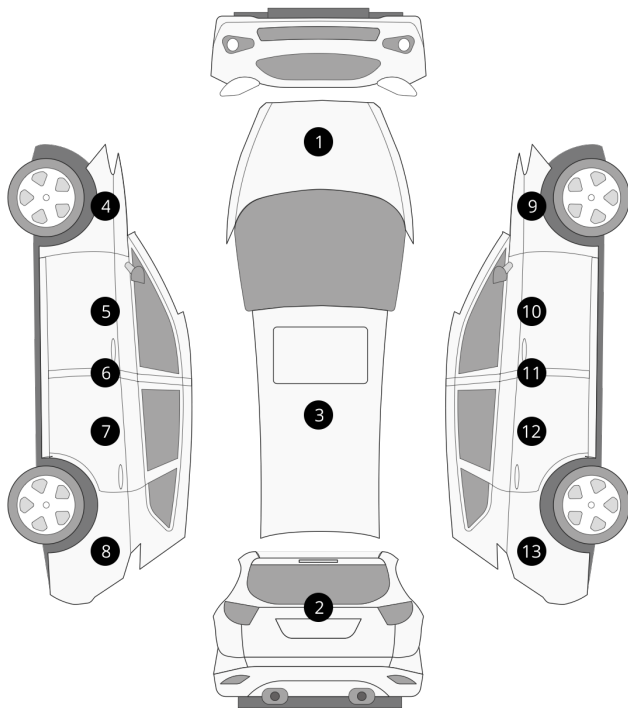


General Information

Date & Time: 24, Jan, 2025 16:04

Make	Toyota	Model	Vios
YOM	2021	Mileage	55,741
Registration No.	DAP2501	Chassis No.	PA1B18F31M4158923
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



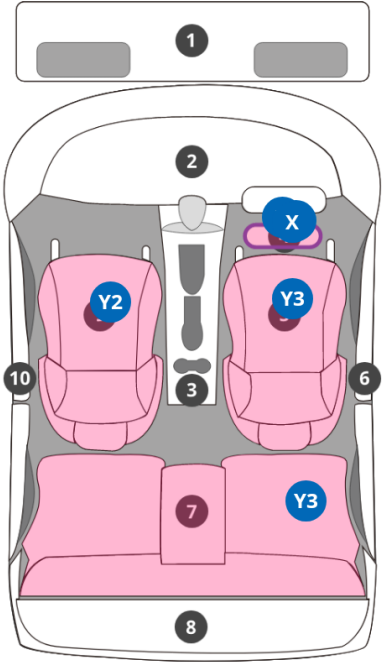
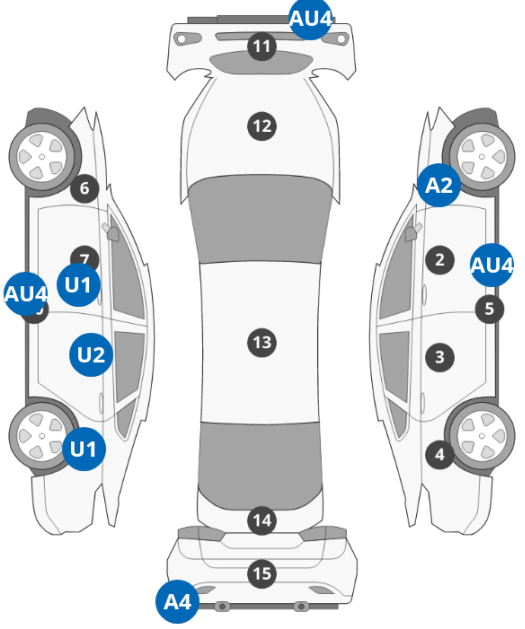
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	112	117	115
2	Boot Lid	112.6	113	108	117
3	Roof	96.5	99	91	96/100
4	Left Front Fender	94.5	92	100	93
5	Left Front Door	114.6	101	137	106
6	Center Panel Left				
7	Left Rear Door	98.6	101	98	97
8	Left Back Panel	105.6	110	106	101
9	Right Front Fender	614.0	165	460	1,217
10	Right Front Door	109.6	104	123	102
11	Center Panel Right				
12	Right Rear Door	101.1	101	94	108
13	Right Back Panel	99.9	100	93	107

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes	Remarks (R) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Dent - Minimal / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate number/no reverse camera/no spare tire/no jack /tools/no warranty booklet.