

General Information

Date & Time: 10, Feb, 2026 17:25

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	16,778
Registration No.	NJA1792	Chassis No.	PA1B18F33R4271179
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



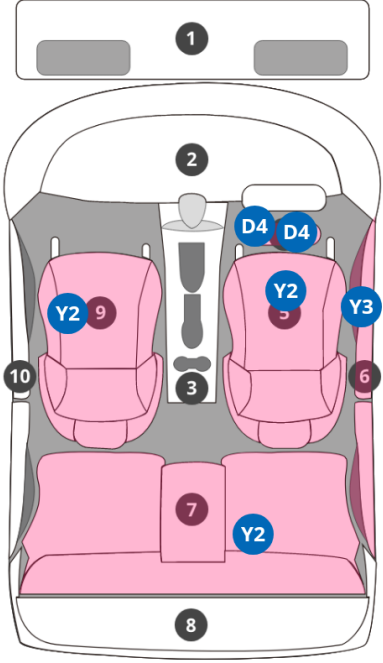
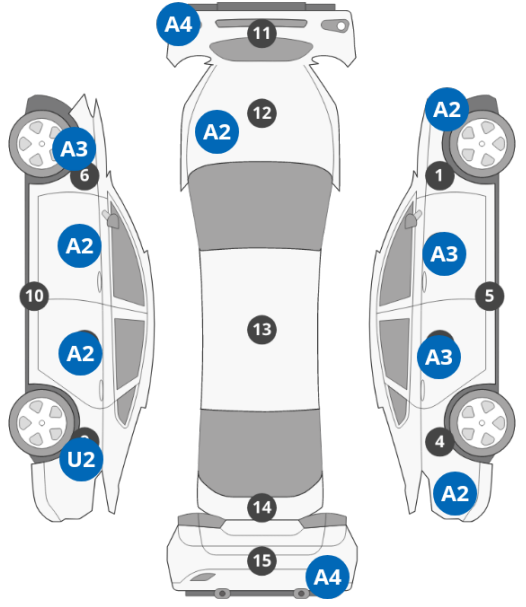
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	108	119	115
2	Boot Lid	112.3	106	112	119
3	Roof	111.7	105	109	108/125
4	Left Front Fender	107.3	117	103	102
5	Left Front Door	109.0	117	103	107
6	Center Panel Left				
7	Left Rear Door	105.6	111	105	101
8	Left Back Panel	112.3	115	107	115
9	Right Front Fender	106.0	106	104	108
10	Right Front Door	113.0	122	106	111
11	Center Panel Right				
12	Right Rear Door	107.6	102	106	115
13	Right Back Panel	116.3	110	119	120

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Worked - Large / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Large / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>no warranty booklet and LTO plate/ no tools/ with jack and spare tire</p>