

General Information

Date & Time: 10, Feb, 2026 10:44

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	9,322
Registration No.	NJF7390	Chassis No.	PA1B18F35S4289981
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



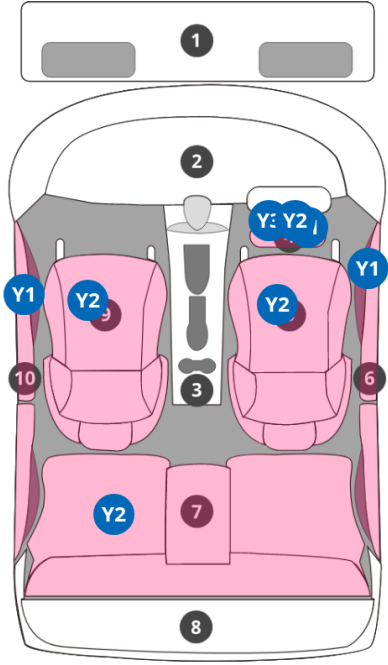
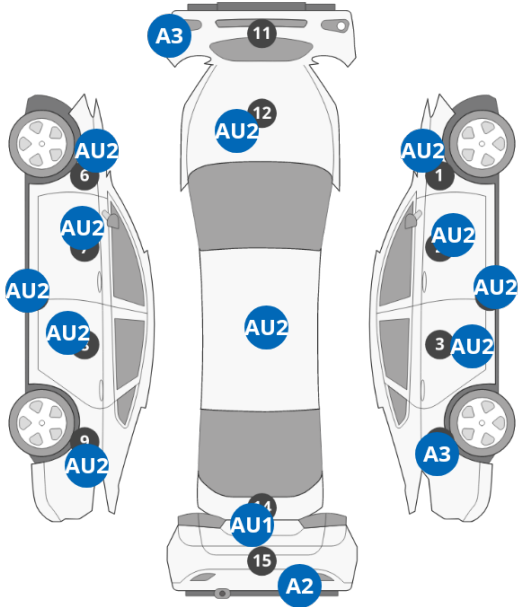
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.5	124	96	115
2	Boot Lid	112.6	113	107	118
3	Roof	104.3	109	103	94/112
4	Left Front Fender	135.6	143	132	132
5	Left Front Door	97.1	96	97	98
6	Center Panel Left				
7	Left Rear Door	98.5	103	97	96
8	Left Back Panel	103.4	112	105	93
9	Right Front Fender	146.6	153	143	144
10	Right Front Door	104.6	111	103	100
11	Center Panel Right				
12	Right Rear Door	106.4	109	99	111
13	Right Back Panel	110.0	105	106	119

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / Mat Other - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal</p>	<p>Remarks Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with tools and jack, with reverse camera, with spare key, with manual and warranty booklet, issue on taillight lens right side, scratches on headlight.</p>