

General Information

Date & Time: 09, Feb, 2026 10:11

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	36,084
Registration No.	NKB7266	Chassis No.	PA1B18F32R4253224
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



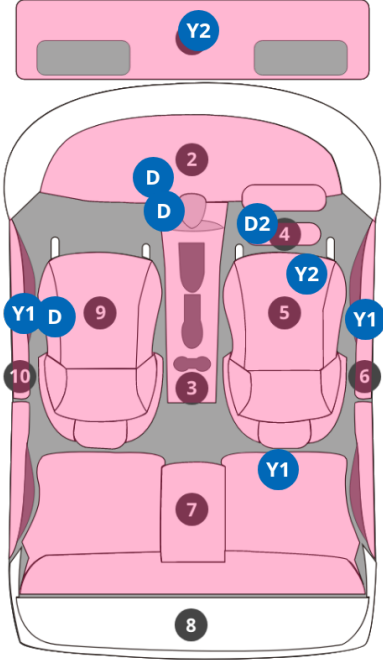
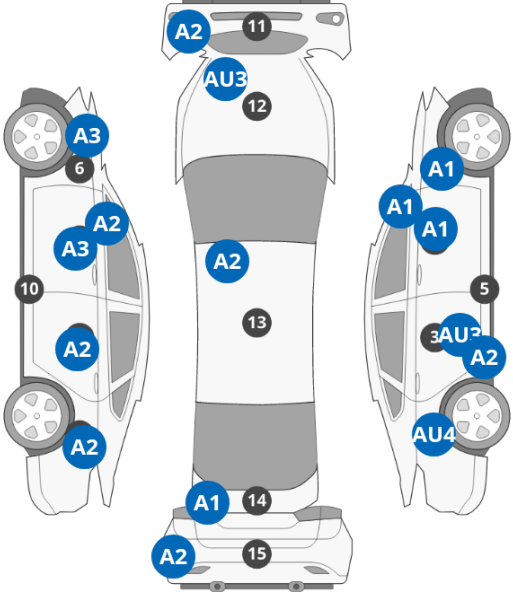
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.3	102	104	107
2	Boot Lid	99.8	100	99	101
3	Roof	95.0	99	97	88/95
4	Left Front Fender	100.1	99	105	96
5	Left Front Door	98.2	101	95	99
6	Center Panel Left				
7	Left Rear Door	100.1	95	93	112
8	Left Back Panel	108.0	108	100	116
9	Right Front Fender	97.7	97	102	94
10	Right Front Door	96.7	98	98	95
11	Center Panel Right				
12	Right Rear Door	96.3	98	93	98
13	Right Back Panel	95.9	95	93	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Small / Ceiling - Grime - Small / Rear Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>	
<p>with warranty booklet, with jack, incomplete tools, with spare tire and LTO PLATE, scratches on tail light</p>	