

General Information

Date & Time: 03, Feb, 2026 18:56

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	8,582
Registration No.	DBP6217	Chassis No.	PA1B18F35R4264850
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



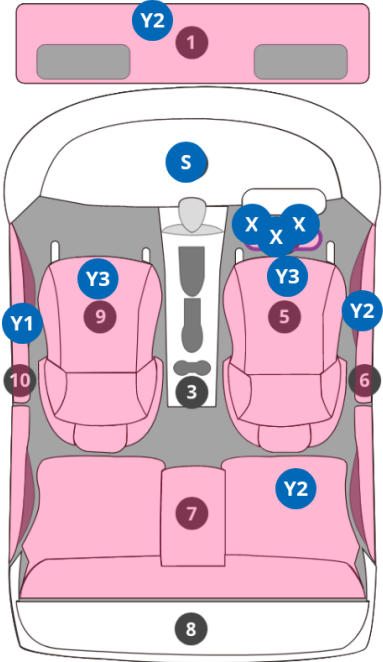
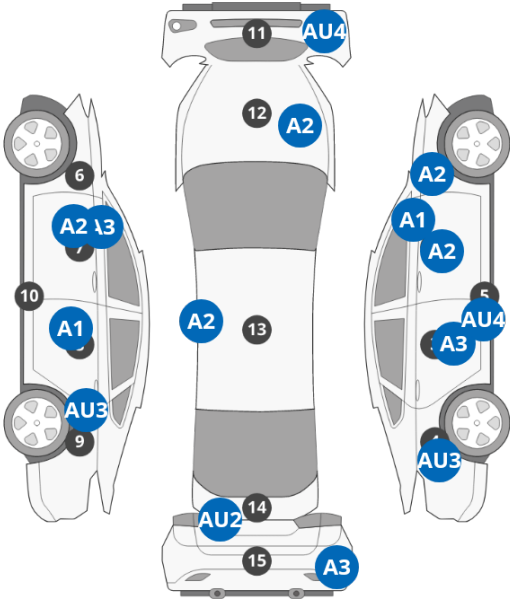
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	112	115	114
2	Boot Lid	135.6	111	100	196
3	Roof	100.7	104	102	98/99
4	Left Front Fender	100.6	102	100	100
5	Left Front Door	105.3	111	100	105
6	Center Panel Left				
7	Left Rear Door	103.0	101	102	106
8	Left Back Panel	119.6	130	113	116
9	Right Front Fender	106.3	107	104	108
10	Right Front Door	105.6	102	114	101
11	Center Panel Right				
12	Right Rear Door	106.0	103	107	108
13	Right Back Panel	101.6	103	98	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Overall Interior - Smell - Yes / Ceiling - Grime - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / Rear Seat - Grime - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Mirror - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, no tools, with spare, with LTO plate, scratched and cracked headlight and tail light, power steering issue due to weak battery</p>