

General Information

Date & Time: 06, Feb, 2026 15:41

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	24,953
Registration No.	DBP9465	Chassis No.	PA1B18F38R4267306
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



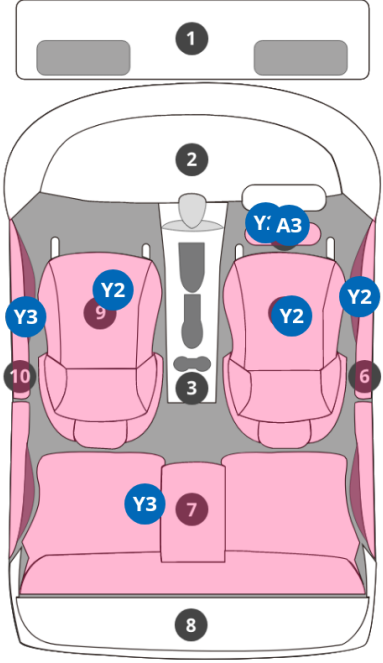
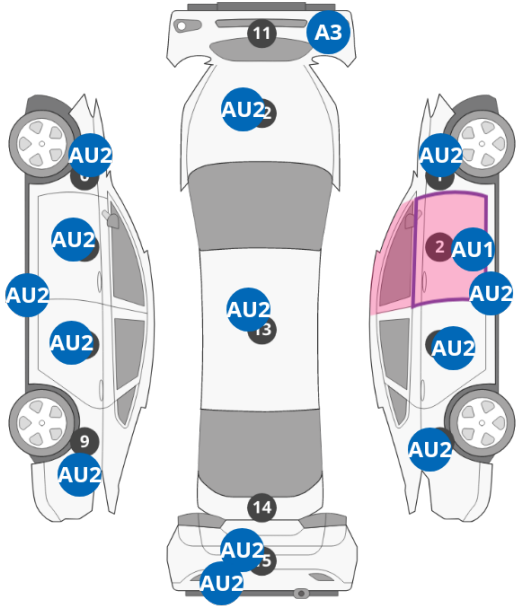
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	134.6	144	116	144
2	Boot Lid	120.6	119	108	135
3	Roof	114.5	126	118	109/105
4	Left Front Fender	104.3	102	102	109
5	Left Front Door	110.0	107	110	113
6	Center Panel Left				
7	Left Rear Door	111.0	119	110	104
8	Left Back Panel	111.3	126	105	103
9	Right Front Fender	115.0	118	109	118
10	Right Front Door	244.6	456	140	138
11	Center Panel Right				
12	Right Rear Door	160.3	133	171	177
13	Right Back Panel	115.3	106	110	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small</p>	<p>Remarks Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with spare key, with manual and warranty booklet, with reverse camera, issue on headlight and taillight lens, issue on side mirror left side missing trim.</p>