

General Information

Date & Time: 06, Feb, 2026 15:40

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	8,877
Registration No.	DBS3408	Chassis No.	PA1B18F38R4274384
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



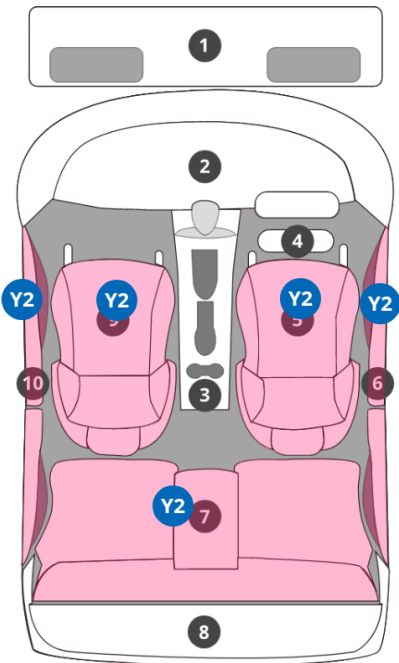
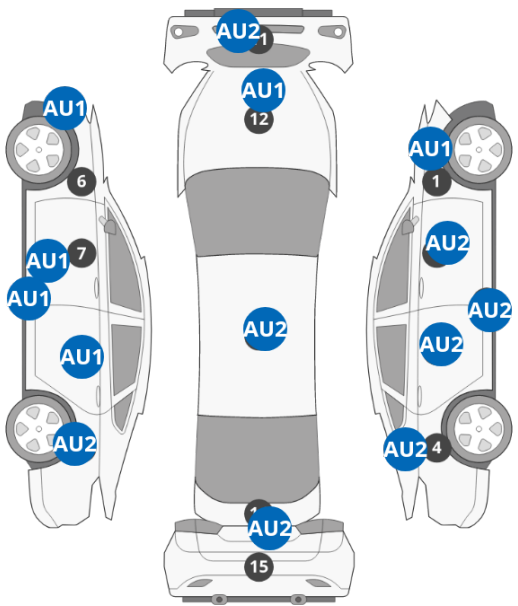
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.8	121	99	104
2	Boot Lid	116.0	112	110	126
3	Roof	98.2	97	97	98/101
4	Left Front Fender	102.1	106	98	102
5	Left Front Door	104.6	101	101	112
6	Center Panel Left				
7	Left Rear Door	101.9	110	97	99
8	Left Back Panel	108.0	114	108	102
9	Right Front Fender	106.0	117	101	100
10	Right Front Door	105.3	117	101	98
11	Center Panel Right				
12	Right Rear Door	105.6	101	102	114
13	Right Back Panel	104.0	102	104	106

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small</p>	<p>Remarks (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with spare key, with incomplete tools and jack, with reverse camera, with manual and warranty booklet, reverse light issue, scratches on taillight and headlight.</p>