

General Information

Date & Time: 30, Jan, 2026 09:36

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	19,879
Registration No.	DBO4986	Chassis No.	PA1B18F36R4240086
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



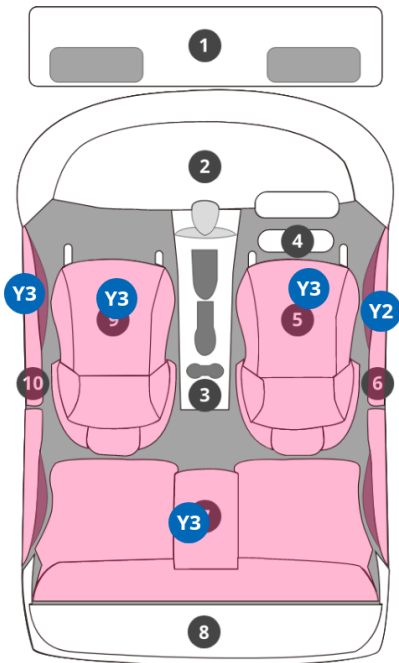
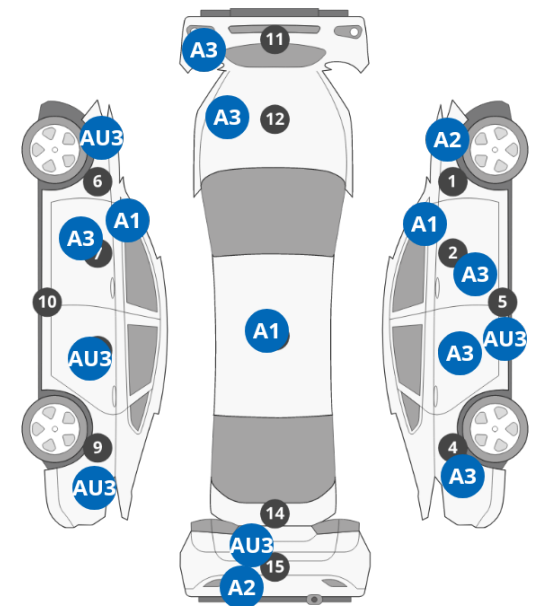
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.8	111	99	99
2	Boot Lid	92.6	91	92	95
3	Roof	83.4	92	83	75/84
4	Left Front Fender	86.9	89	84	88
5	Left Front Door	92.0	90	97	89
6	Center Panel Left				
7	Left Rear Door	95.6	99	98	91
8	Left Back Panel	96.1	107	91	90
9	Right Front Fender	88.3	91	87	87
10	Right Front Door	86.8	85	87	89
11	Center Panel Right				
12	Right Rear Door	85.3	84	85	87
13	Right Back Panel	89.3	85	86	98

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium</p>	<p>Remarks (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with jack and incomplete tools/with reverse camera/with warranty booklet/No seat cover</p>