

General Information

Date & Time: 28, Jan, 2026 14:49

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	12,846
Registration No.	DBQ5846	Chassis No.	PA1B18F30R4266019
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



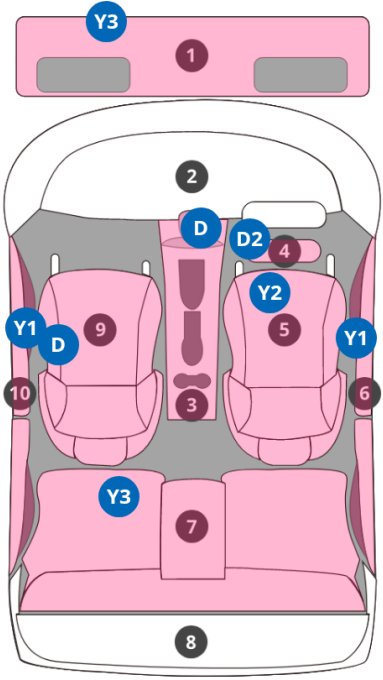
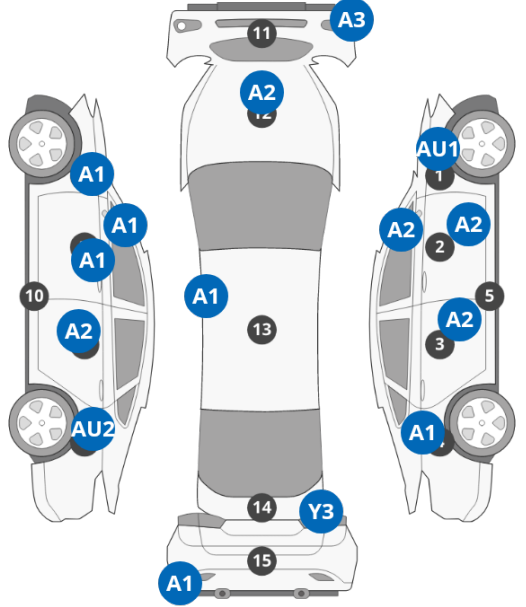
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	117	109	112
2	Boot Lid	112.0	105	117	114
3	Roof	126.2	109	101	192/103
4	Left Front Fender	101.3	101	100	103
5	Left Front Door	107.6	110	105	108
6	Center Panel Left				
7	Left Rear Door	116.0	120	120	108
8	Left Back Panel	363.6	746	195	150
9	Right Front Fender	108.0	108	107	109
10	Right Front Door	108.6	109	114	103
11	Center Panel Right				
12	Right Rear Door	110.6	112	111	109
13	Right Back Panel	113.0	117	106	116

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / Ceiling - Grime - Medium / Console, Switches, Vents - Traces of Adhesive Tape - Yes</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Crack, Gap - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light</p>