

General Information

Date & Time: 30, Jan, 2026 10:33

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	6,800
Registration No.	DBT4737	Chassis No.	PA1B18F39S4284704
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



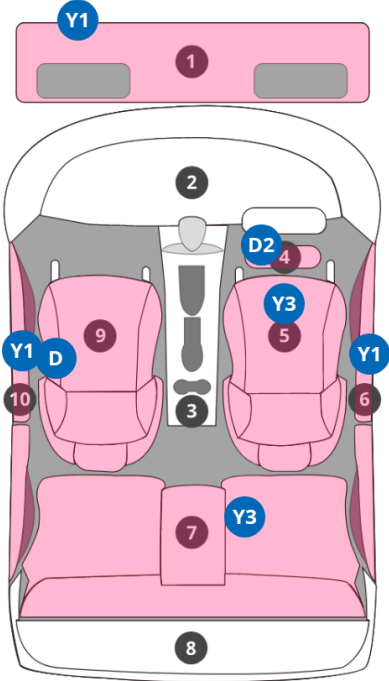
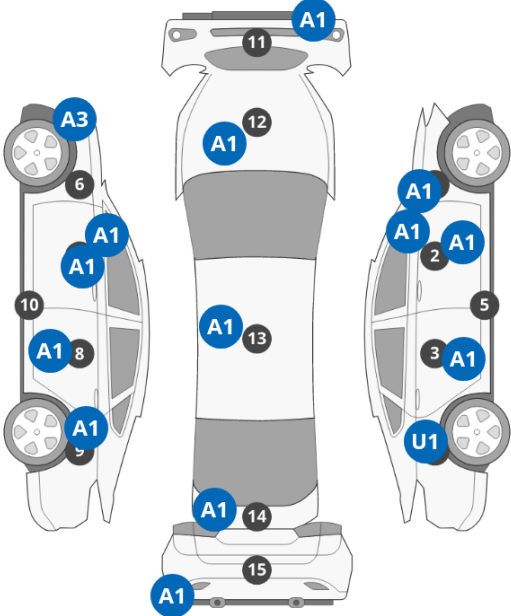
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	109	113	108
2	Boot Lid	104.3	109	98	106
3	Roof	96.0	96	103	90/95
4	Left Front Fender	96.8	95	97	98
5	Left Front Door	96.7	92	100	99
6	Center Panel Left				
7	Left Rear Door	96.0	95	100	93
8	Left Back Panel	104.5	110	106	98
9	Right Front Fender	91.8	90	97	88
10	Right Front Door	98.8	100	100	97
11	Center Panel Right				
12	Right Rear Door	99.5	103	97	99
13	Right Back Panel	102.4	104	95	108

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light</p>