

General Information

Date & Time: 30, Jan, 2026 08:45

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	20,242
Registration No.	DCA1911	Chassis No.	MHKAA1BC5SJ039457
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



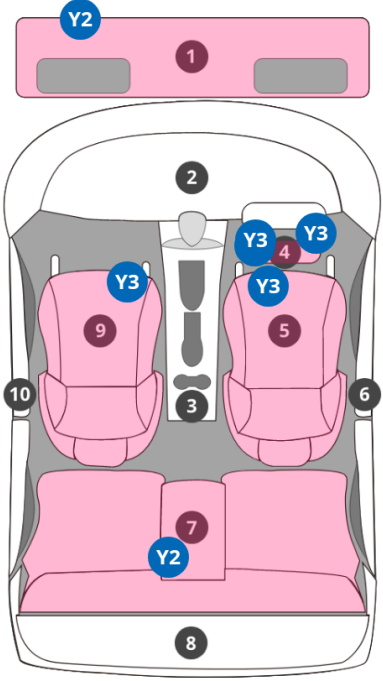
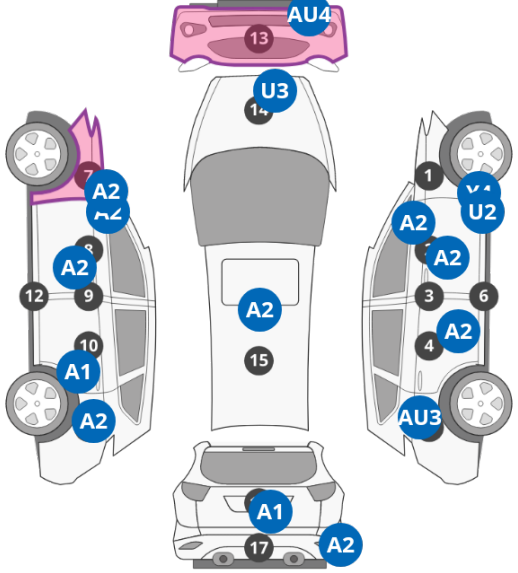
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.5	108	112	88
2	Boot Lid	101.0	105	98	100
3	Roof	107.3	102	122	108/98
4	Left Front Fender	102.0	111	98	97
5	Left Front Door	117.0	132	101	118
6	Center Panel Left				
7	Left Rear Door	102.4	106	103	98
8	Left Back Panel	106.3	105	105	109
9	Right Front Fender	117.3	107	115	130
10	Right Front Door	124.0	102	168	102
11	Center Panel Right				
12	Right Rear Door	110.6	107	101	124
13	Right Back Panel	103.5	108	99	104

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Ceiling - Grime - Small / Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Medium</p>	<p>Remarks (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Crack, Gap - Large / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Dent - Medium / Roof - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light</p>