

General Information

Date & Time: 02, Feb, 2026 14:19

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	119,275
Registration No.	NHI3524	Chassis No.	MHFAA1BY2N0008185
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	Black		

Body / Panel Condition



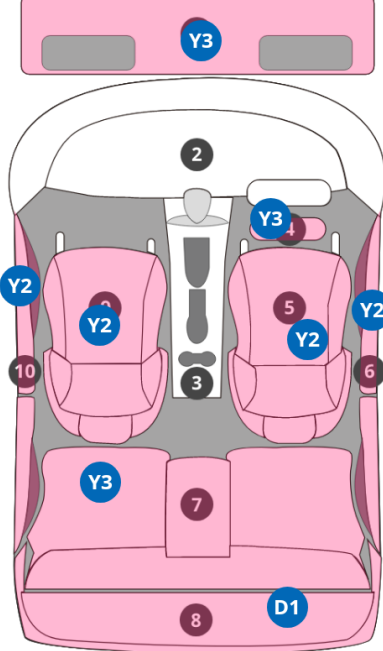
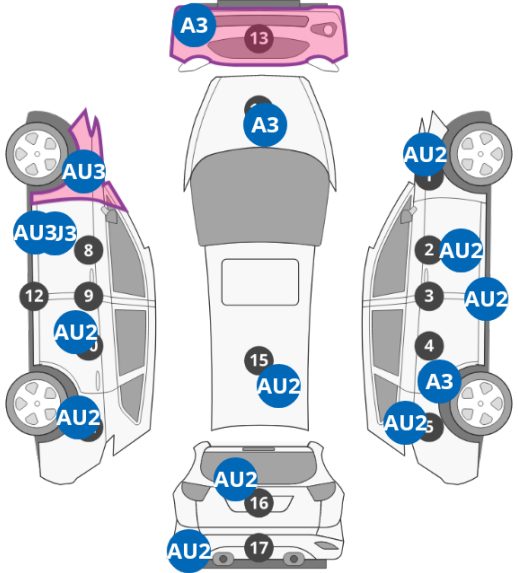
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	115	115	107
2	Boot Lid	139.6	131	123	165
3	Roof	123.2	126	118	138/111
4	Left Front Fender	190.0	203	203	164
5	Left Front Door	160.0	152	158	170
6	Center Panel Left				
7	Left Rear Door	125.6	118	114	145
8	Left Back Panel	157.0	125	125	221
9	Right Front Fender	300.0	165	549	186
10	Right Front Door	119.3	123	117	118
11	Center Panel Right				
12	Right Rear Door	117.6	127	111	115
13	Right Back Panel	160.6	148	168	166

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / Ceiling - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Trunk Room - Worked - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack, with reverse camera, with warranty booklet, issue on foglamps, issue on headlight switch, scratches on taillight and headlight.</p>