

General Information

Date & Time: 28, Jan, 2026 13:12

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	16,497
Registration No.	NHU9230	Chassis No.	MHKAA1BCORJ029414
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



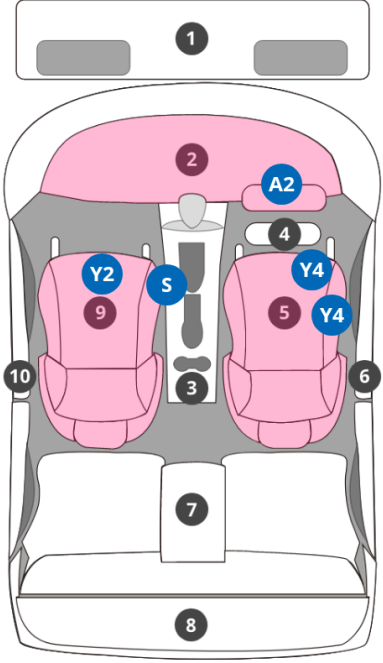
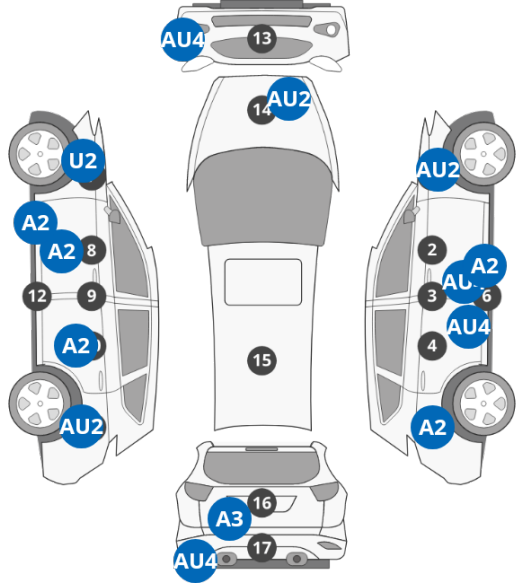
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	112	111	117
2	Boot Lid	81.5	82	84	79
3	Roof	83.0	87	74	87/84
4	Left Front Fender	86.3	81	95	83
5	Left Front Door	100.5	97	98	106
6	Center Panel Left				
7	Left Rear Door	98.5	104	96	95
8	Left Back Panel	95.3	101	91	94
9	Right Front Fender	84.2	86	84	83
10	Right Front Door	103.1	111	103	95
11	Center Panel Right				
12	Right Rear Door	102.1	105	94	107
13	Right Back Panel	91.3	96	87	90

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Large / (R) Front Seat belt - Grime - Large / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Fender, Molding - Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>incomplete tools/ possible flooding/ maintenance warning lamp on/with jack and spare tire/ with LTO plate/</p>