

General Information

Date & Time: 28, Jan, 2026 15:12

Make	Toyota	Model	Raize
YOM	2025	Odo Meter Reading	14,588
Registration No.	NJA1048	Chassis No.	MHKAB1BAXRJ102316
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



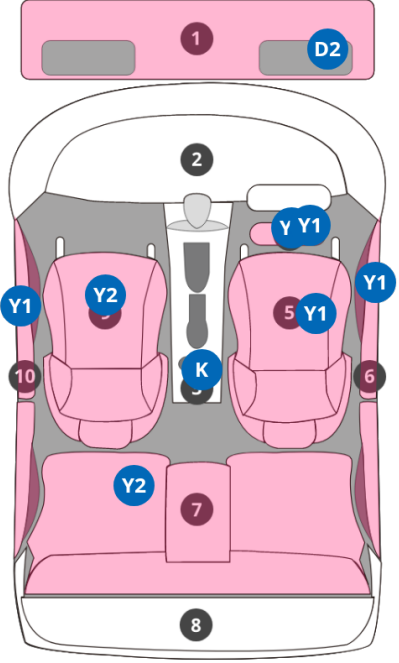
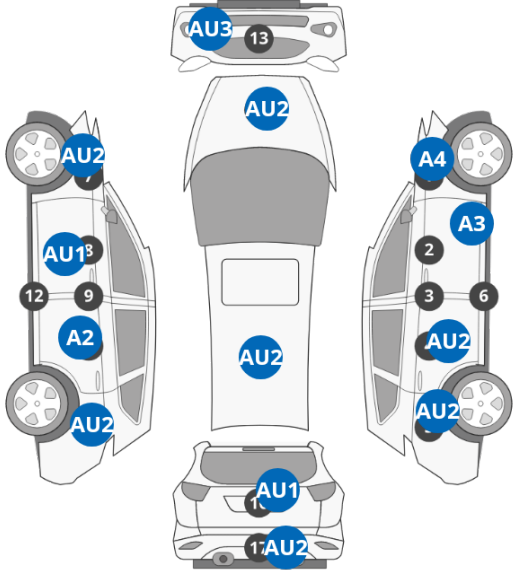
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.1	98	96	92
2	Boot Lid	90.0	90	100	81
3	Roof	102.0	106	97	92/113
4	Left Front Fender	93.4	86	100	95
5	Left Front Door	101.0	99	105	99
6	Center Panel Left				
7	Left Rear Door	103.7	107	110	94
8	Left Back Panel	96.2	92	93	104
9	Right Front Fender	92.5	95	99	83
10	Right Front Door	101.5	101	99	105
11	Center Panel Right				
12	Right Rear Door	98.0	93	100	101
13	Right Back Panel	82.9	81	84	84

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Animal Hair - Yes / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / Sunvisor, Sunglass Holder - Crinkle - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal</p>	<p>Remarks Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack and incomplete tools, with reverse camera, with spare key, with manual and warranty booklet, scratches on taillight and headlight.</p>