

General Information

Date & Time: 30, Jan, 2026 08:28

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	4,113
Registration No.	NJA9441	Chassis No.	MHKAA1BC4SJ035870
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



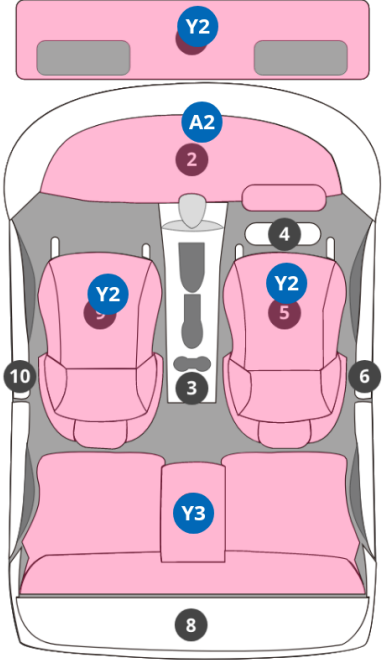
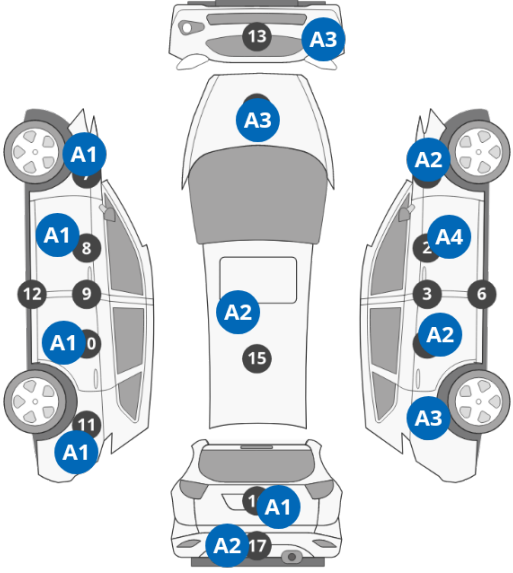
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	107	100	111
2	Boot Lid	92.1	92	92	93
3	Roof	90.4	94	91	91/86
4	Left Front Fender	94.8	86	100	98
5	Left Front Door	95.0	99	92	94
6	Center Panel Left				
7	Left Rear Door	98.7	108	92	97
8	Left Back Panel	87.2	85	88	89
9	Right Front Fender	97.3	98	100	94
10	Right Front Door	100.0	98	93	109
11	Center Panel Right				
12	Right Rear Door	99.8	105	94	100
13	Right Back Panel	88.8	87	87	93

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / Ceiling - Grime - Small</p>	<p>Remarks Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Roof - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with jack No tools/with reverse camera/No warranty booklet/with seat cover</p>