

General Information

Date & Time: 28, Jan, 2026 14:56

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	8,332
Registration No.	NJC9693	Chassis No.	PA1B18F37S4290677
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



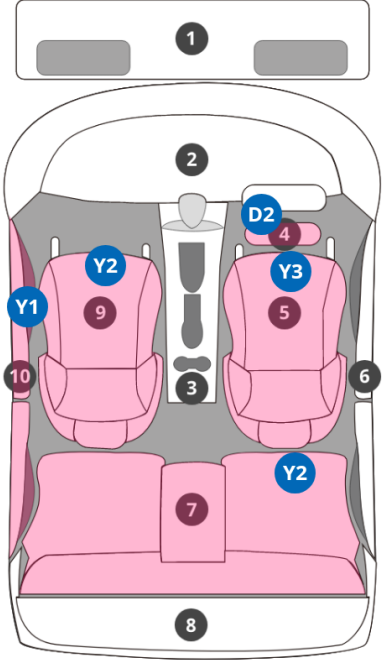
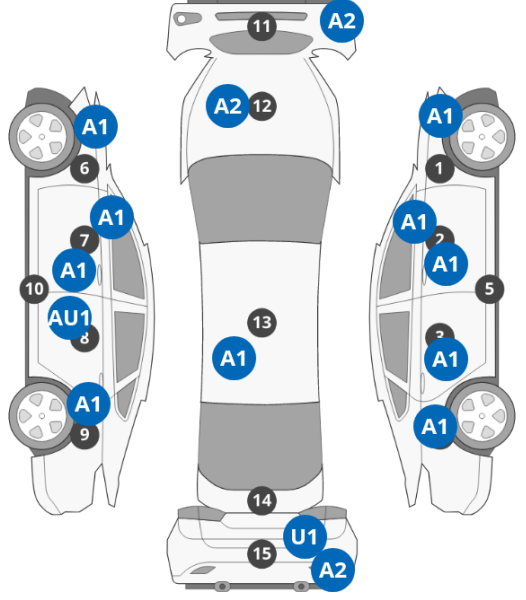
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	115	116	113
2	Boot Lid	110.6	115	109	108
3	Roof	110.7	107	125	102/109
4	Left Front Fender	98.6	101	97	98
5	Left Front Door	99.9	98	100	102
6	Center Panel Left				
7	Left Rear Door	106.2	110	110	99
8	Left Back Panel	106.3	109	108	102
9	Right Front Fender	117.0	114	118	119
10	Right Front Door	113.6	110	117	114
11	Center Panel Right				
12	Right Rear Door	110.3	111	106	114
13	Right Back Panel	114.3	108	104	131

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with warranty booklet and jack, no tools, with spare tire, with LTO plate, scratches on tail light</p>