

General Information

Date & Time: 30, Jan, 2026 14:28

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	24,305
Registration No.	NJF1058	Chassis No.	PA1B18F38R4270965
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



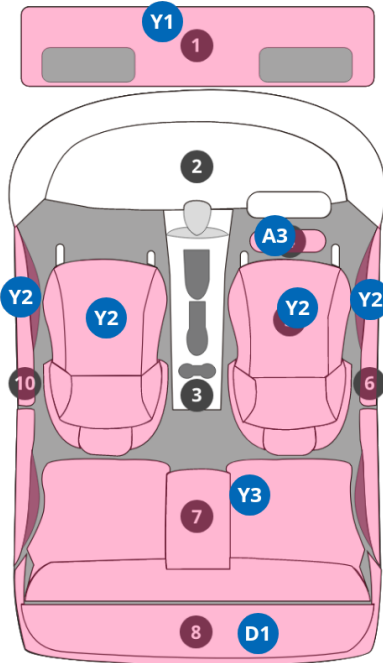
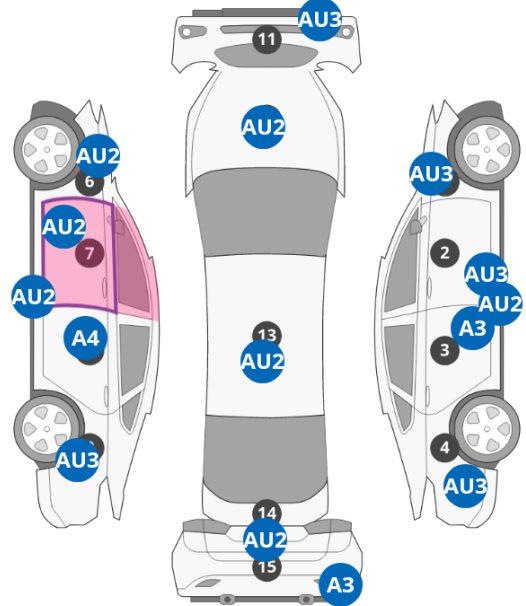
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	185.6	160	194	203
2	Boot Lid	120.0	112	119	129
3	Roof	107.0	110	109	105/104
4	Left Front Fender	110.6	122	103	107
5	Left Front Door	196.3	325	125	139
6	Center Panel Left				
7	Left Rear Door	111.6	126	107	102
8	Left Back Panel	107.3	108	110	104
9	Right Front Fender	121.3	129	123	112
10	Right Front Door	104.3	109	102	102
11	Center Panel Right				
12	Right Rear Door	109.0	103	103	121
13	Right Back Panel	107.8	120	97	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Trunk Room - Worked - Minimal / Ceiling - Grime - Minimal</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, inc tools and jack, with reverse camera, with manual and warranty booklet, no spare key, scratches on taillight and headlight</p>