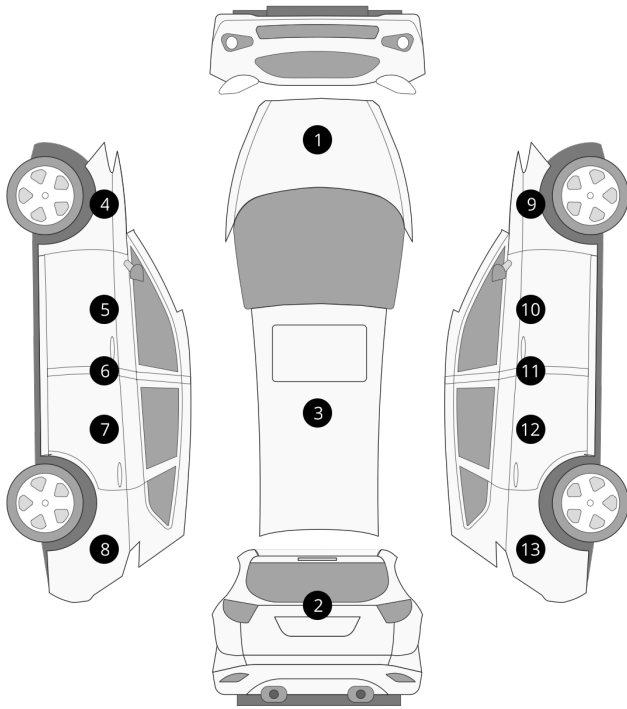


General Information

Date & Time: 28, Jan, 2026 15:14

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	8,995
Registration No.	NJF5563	Chassis No.	PA1B18F38S4286573
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



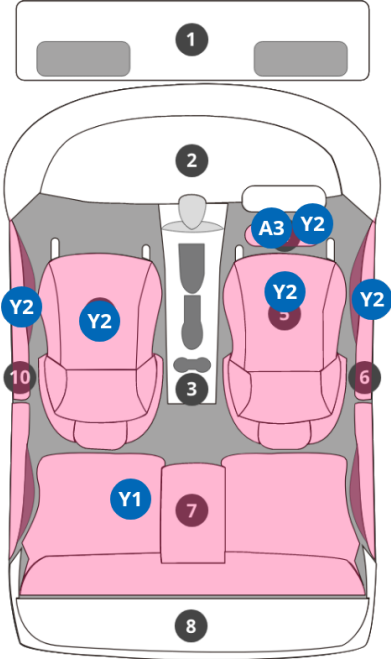
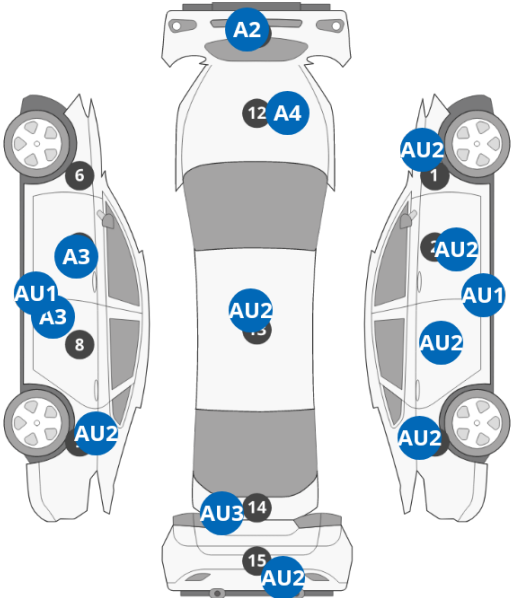
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	128	100	114
2	Boot Lid	116.0	114	121	113
3	Roof	101.8	102	105	96/105
4	Left Front Fender	99.3	93	102	103
5	Left Front Door	101.6	100	104	101
6	Center Panel Left				
7	Left Rear Door	101.2	105	101	98
8	Left Back Panel	102.0	107	104	95
9	Right Front Fender	105.0	108	101	106
10	Right Front Door	107.0	104	106	111
11	Center Panel Right				
12	Right Rear Door	114.3	115	108	120
13	Right Back Panel	108.0	102	100	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small</p>	<p>Remarks Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with reverse camera, with manual booklet, no spare key, no tools and jack, no spare key, issue indicator lamp on, scratches on taillight and headlight.</p>