

General Information

Date & Time: 28, Jan, 2026 12:59

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	6,353
Registration No.	NKH2814	Chassis No.	PA1B18F39R4279139
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



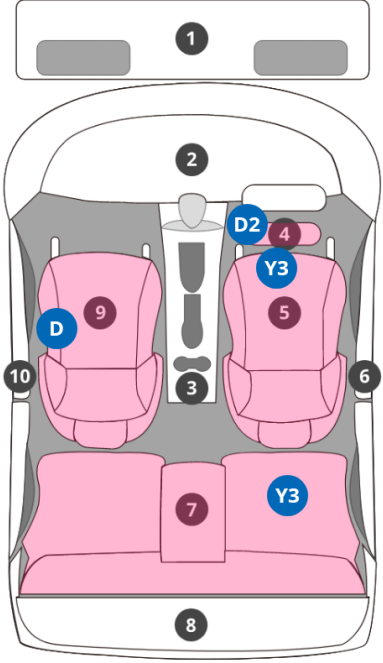
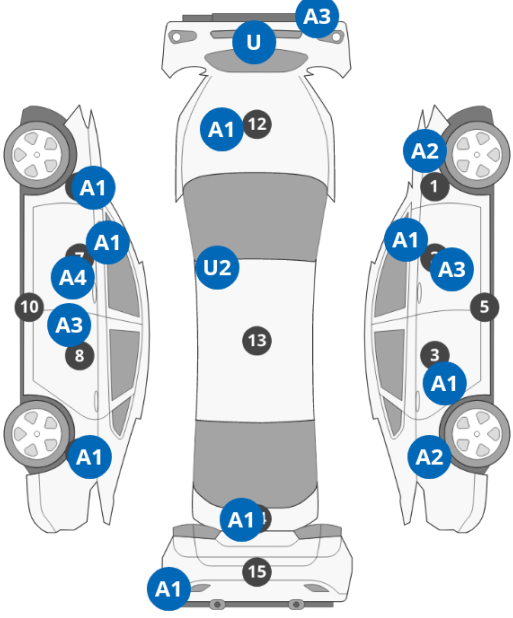
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.3	120	109	117
2	Boot Lid	107.6	107	99	117
3	Roof	109.5	113	114	98/113
4	Left Front Fender	102.4	106	104	97
5	Left Front Door	107.3	114	106	102
6	Center Panel Left				
7	Left Rear Door	105.6	108	106	103
8	Left Back Panel	135.3	133	121	152
9	Right Front Fender	104.3	103	107	103
10	Right Front Door	117.3	116	115	121
11	Center Panel Right				
12	Right Rear Door	111.0	105	115	113
13	Right Back Panel	106.0	106	102	110

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes</p>	<p>Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light</p>