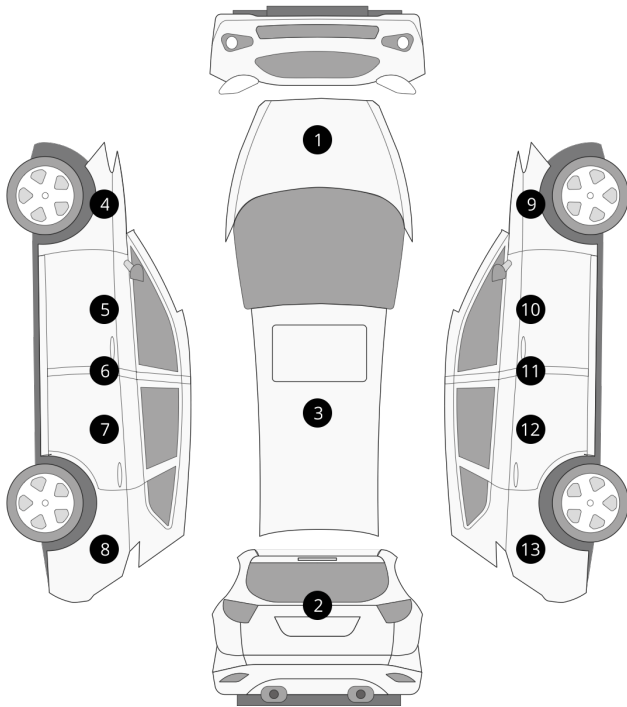


General Information

Date & Time: 26, Jan, 2026 19:55

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	10,756
Registration No.	FAS7472	Chassis No.	MHKAA1BC8RJ034179
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



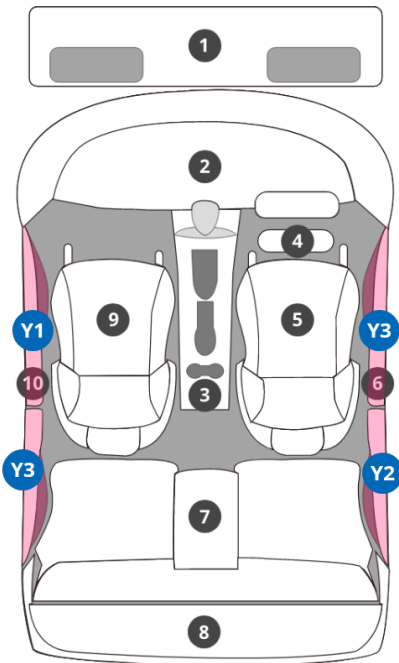
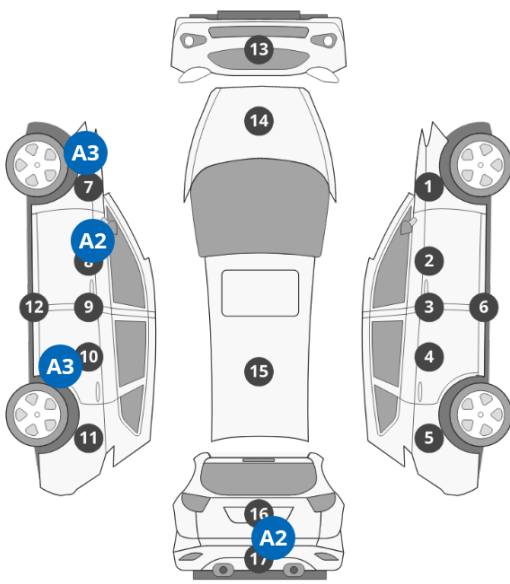
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	104	101	113
2	Boot Lid	105.5	97	122	98
3	Roof	101.9	106	95	108/99
4	Left Front Fender	104.4	107	96	110
5	Left Front Door	103.2	102	92	116
6	Center Panel Left				
7	Left Rear Door	104.0	102	100	110
8	Left Back Panel	95.0	91	101	93
9	Right Front Fender	127.0	115	135	131
10	Right Front Door	108.2	102	98	125
11	Center Panel Right				
12	Right Rear Door	100.1	102	94	105
13	Right Back Panel	97.3	96	101	95

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Minimal</p>	<p>Remarks Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With LTO plate/ with spare tire/ with 1 Spare key/with warranty booklet/ with jack no tools/ with seat cover</p>