

General Information

Date & Time: 27, Jan, 2026 17:11

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	38,512
Registration No.	GAP2790	Chassis No.	PA1B18F3XN4197267
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



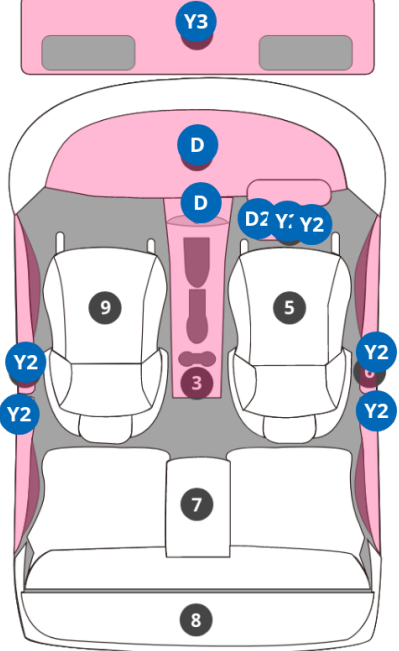
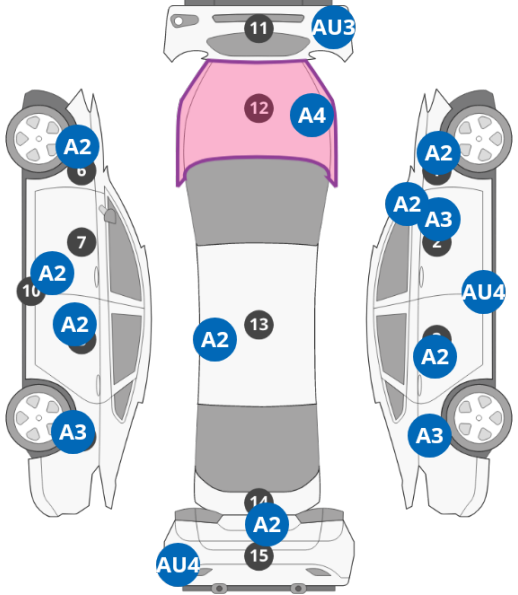
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	178.3	172	163	200
2	Boot Lid	104.3	103	103	107
3	Roof	93.9	94	89	99/94
4	Left Front Fender	100.8	103	100	100
5	Left Front Door	107.3	108	110	104
6	Center Panel Left				
7	Left Rear Door	108.3	106	113	106
8	Left Back Panel	183.0	139	194	216
9	Right Front Fender	97.3	99	93	100
10	Right Front Door	98.3	103	96	96
11	Center Panel Right				
12	Right Rear Door	103.0	97	100	112
13	Right Back Panel	105.3	106	101	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Medium / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / Mat Other - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small</p>	<p>Remarks (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Large / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Gap at front and rear bumper. Faded paint at bonnet. With warranty booklet, spare tire, jack and seat cover. Without tools. 1 key. With LTO plate.</p>