

General Information

Date & Time: 26, Jan, 2026 16:31

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	6,375
Registration No.	NJC3573	Chassis No.	PAHAD9DA7S1627281
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Dropside
Colour	Black		

Body / Panel Condition



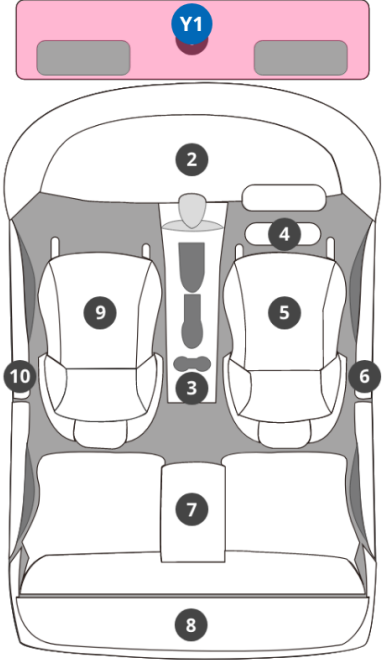
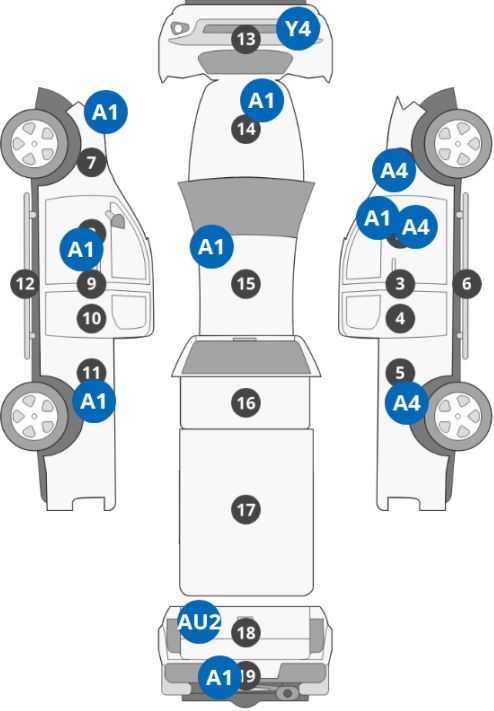
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.8	105	104	97
2	Boot Lid	73.5	86	63	71
3	Roof	114.7	123	118	104/114
4	Left Front Fender	128.3	122	128	135
5	Left Front Door	103.3	105	104	101
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	80.7	78	90	74
9	Right Front Fender	115.6	120	119	108
10	Right Front Door	107.6	105	109	109
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	93.2	76	114	89

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Guard Frame - Scratch - Large / (L) Side Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
No Lto plate, with warranty booklet, with spare, with jack and tools, Crack headlight, battery weak