

General Information

Date & Time: 09, Feb, 2026 11:23

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	45,191
Registration No.	NKK3056	Chassis No.	PA2JA8EM7R0148817
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



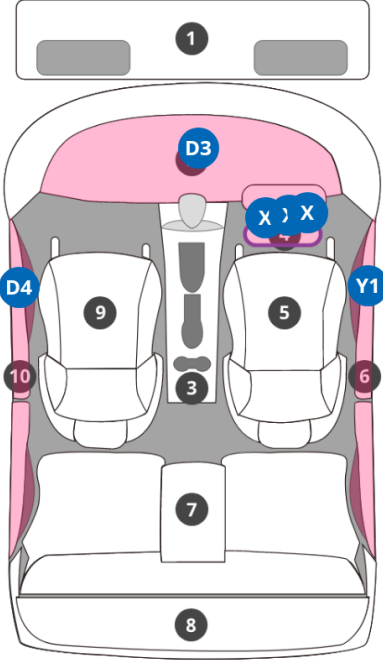
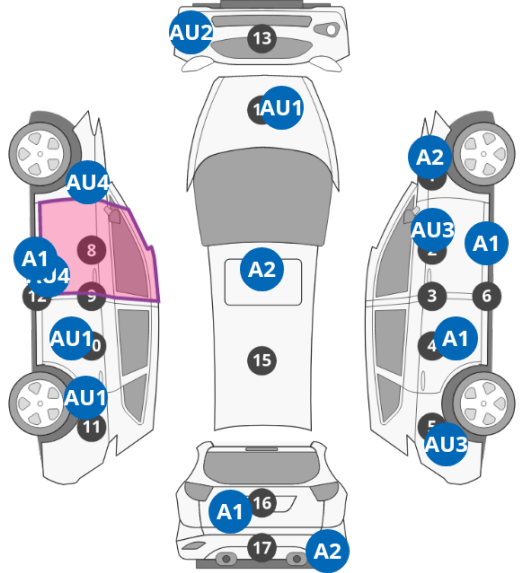
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.7	107	118	98
2	Boot Lid	101.9	103	104	99
3	Roof	93.8	99	94	88/95
4	Left Front Fender	91.1	88	103	82
5	Left Front Door	95.8	93	97	98
6	Center Panel Left				
7	Left Rear Door	99.3	102	95	101
8	Left Back Panel	107.0	111	104	106
9	Right Front Fender	102.9	108	107	94
10	Right Front Door	99.6	102	100	97
11	Center Panel Right				
12	Right Rear Door	101.5	100	98	107
13	Right Back Panel	105.3	107	107	102

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Loose, Deformed - Medium / (L) Front Trim - Loose, Deformed - Large / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Trim - Grime - Minimal</p>	<p>Remarks (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Roof - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal</p>
Frame Evaluation : D	Functional Evaluation : C
<p>Remarks Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire, 2keys, no jack and tools, scratches on headlights and taillights,battery weak, warning lamp on</p>