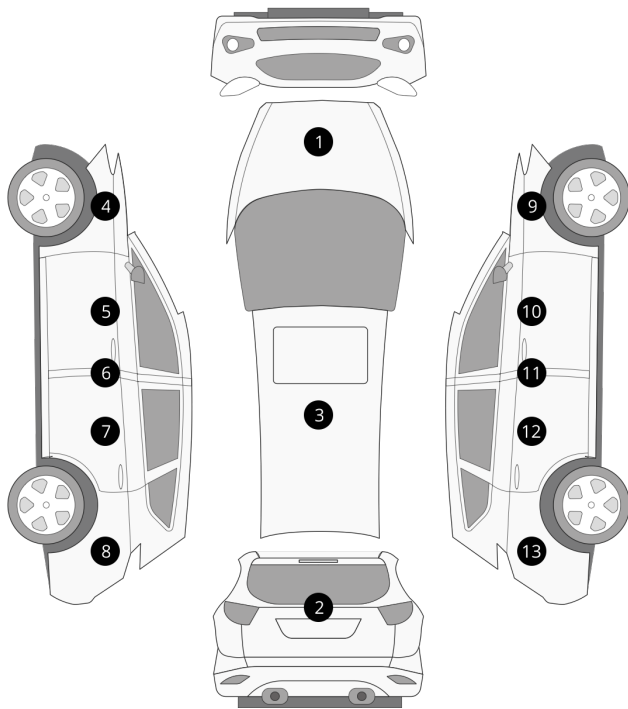


## General Information

Date & Time: 25, Jan, 2025 08:57

|                  |         |              |                   |
|------------------|---------|--------------|-------------------|
| Make             | Toyota  | Model        | Vios              |
| YOM              | 2021    | Mileage      | 33,989            |
| Registration No. | DBB1545 | Chassis No.  | PA1B18F3XL4121688 |
| CC               | 1.3     | Transmission | M/T               |
| Fuel Type        | Gas     | Type of Body | Sedan             |
| Colour           | Silver  |              |                   |

## Body / Panel Condition



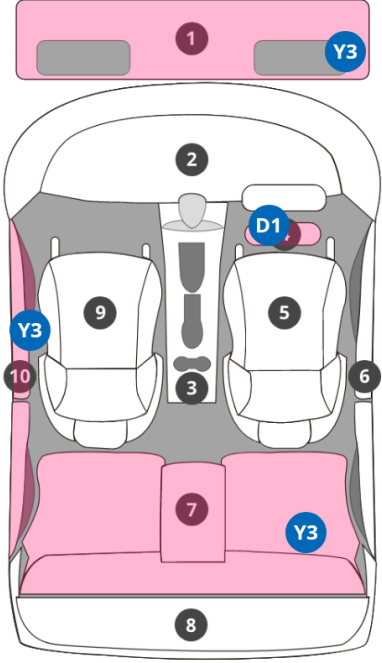
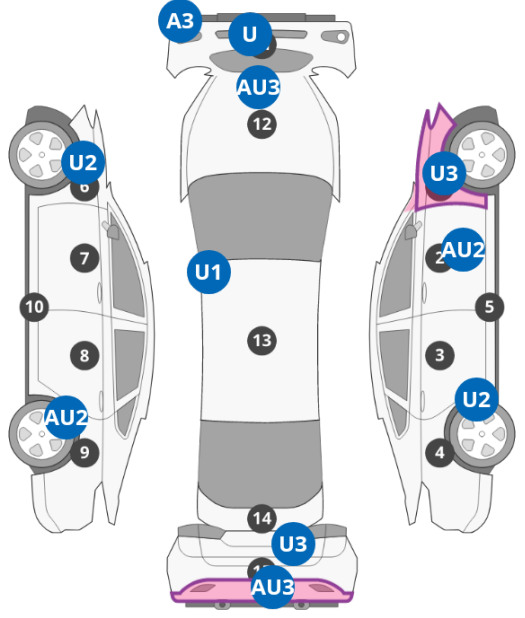
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 110.3         | 115    | 104    | 112      |
| 2  | Boot Lid           | 111.0         | 112    | 109    | 112      |
| 3  | Roof               | 99.9          | 105    | 94     | 97/104   |
| 4  | Left Front Fender  | 90.7          | 89     | 90     | 93       |
| 5  | Left Front Door    | 99.9          | 104    | 100    | 96       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 107.8         | 103    | 132    | 89       |
| 8  | Left Back Panel    | 113.0         | 102    | 107    | 130      |
| 9  | Right Front Fender | 99.7          | 95     | 90     | 114      |
| 10 | Right Front Door   | 93.8          | 94     | 93     | 95       |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 99.5          | 94     | 97     | 107      |
| 13 | Right Back Panel   | 102.2         | 99     | 98     | 110      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

| Interior Evaluation : <b>B</b>                                                                                                                                                                                                                     | Exterior Evaluation : <b>D</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                              |
| <p><b>Remarks</b><br/>Carpet - Worked - Minimal / Ceiling - Grime - Medium / (L) Front Trim - Grime - Medium / Rear Seat - Grime - Medium</p>                                                                                                      | <p><b>Remarks</b><br/>(R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Fender, Molding - Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Roof - Dent - Minimal / (L) Front Fender, Molding - Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch &amp; Dent - Medium</p> |
| Frame Evaluation : <b>A</b>                                                                                                                                                                                                                        | Functional Evaluation : <b>B</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <p><b>Remarks</b><br/>Defects not found</p>                                                                                                                                                                                                        | <p><b>Remarks</b><br/>Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |

| Inspector Notes                                                                      |
|--------------------------------------------------------------------------------------|
| with warrantybooklet, with sparetire, with jack and incomplete tools, with LTO plate |