

General Information

Date & Time: 26, Jan, 2026 16:30

Make	Audi	Model	A1
YOM	2018	Odo Meter Reading	46,999
Registration No.	NEM8735	Chassis No.	WAUZZZZ8X1JB019257
CC	1.4	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



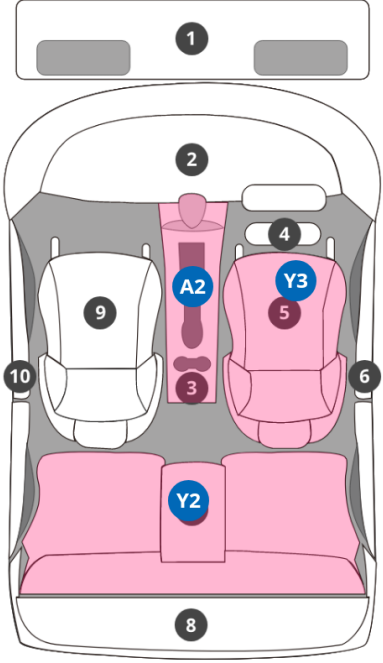
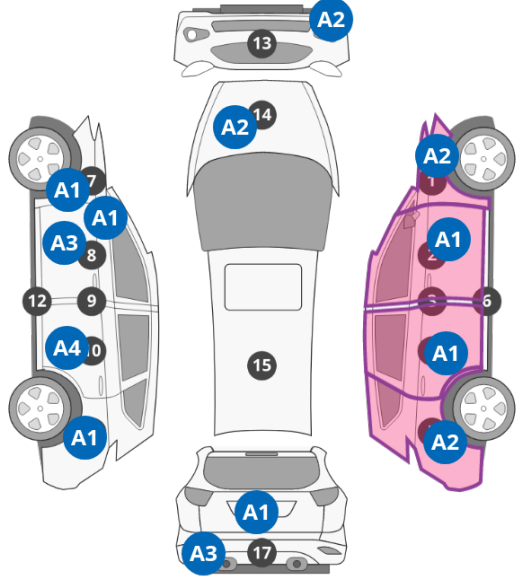
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	224.3	221	230	222
2	Boot Lid	143.6	141	146	144
3	Roof	210.7	187	205	240/211
4	Left Front Fender	138.0	122	161	131
5	Left Front Door	136.6	129	153	128
6	Center Panel Left				
7	Left Rear Door	139.6	137	144	138
8	Left Back Panel	138.3	140	139	136
9	Right Front Fender	182.0	178	190	178
10	Right Front Door	373.3	699	223	198
11	Center Panel Right				
12	Right Rear Door	899.3	969	1,124	605
13	Right Back Panel	218.0	155	233	266

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	D
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Small / Knobs - Worn, Peel, Crack - Small</p>		<p>Remarks Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>	
Frame Evaluation :	A	Functional Evaluation :	C
<p>Remarks Defects not found</p>		<p>Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights and taillights,warning lamp on