

General Information

Date & Time: 26, Jan, 2026 16:28

Make	Lexus	Model	IS 350
YOM	2014	Odo Meter Reading	66,462
Registration No.	WNQ543	Chassis No.	JTHBE5D2105008497
CC	3.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



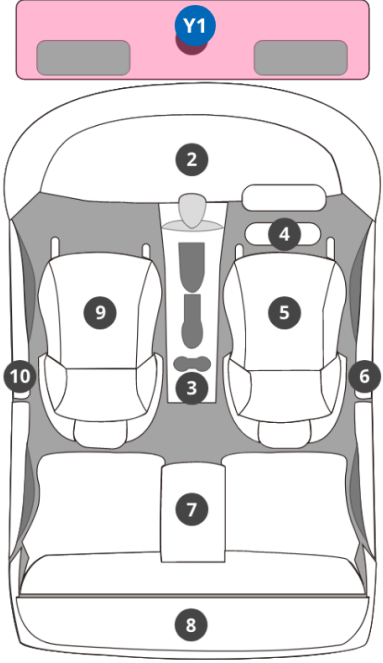
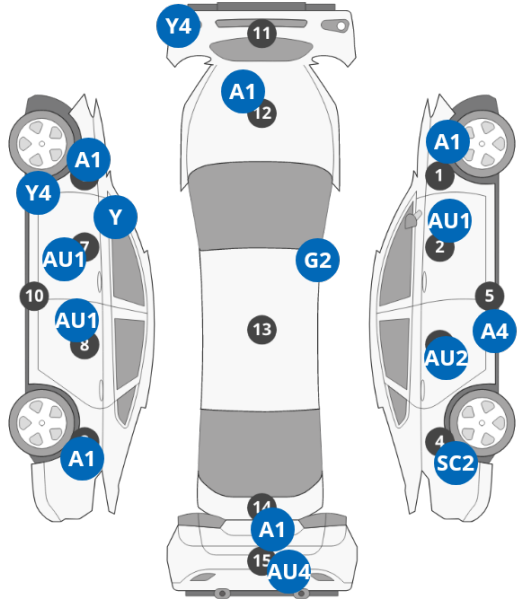
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.3	118	139	125
2	Boot Lid	112.6	104	119	115
3	Roof	147.0	143	147	141/157
4	Left Front Fender	246.0	240	242	256
5	Left Front Door	180.3	200	175	166
6	Center Panel Left				
7	Left Rear Door	132.3	129	142	126
8	Left Back Panel	157.3	162	147	163
9	Right Front Fender	255.6	243	227	297
10	Right Front Door	172.0	159	168	189
11	Center Panel Right				
12	Right Rear Door	253.6	251	230	280
13	Right Back Panel	339.3	316	328	374

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Fender, Molding - Rust, Corrosion - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Crack - Cracks / (L) Step, In-panel, Side Spoiler - Crack, Gap - Large / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : C	Functional Evaluation : A
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights