

General Information

Date & Time: 02, Feb, 2026 08:09

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	26,080
Registration No.	GBE5178	Chassis No.	MR0JB8DD4R3229174
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Gray		

Body / Panel Condition



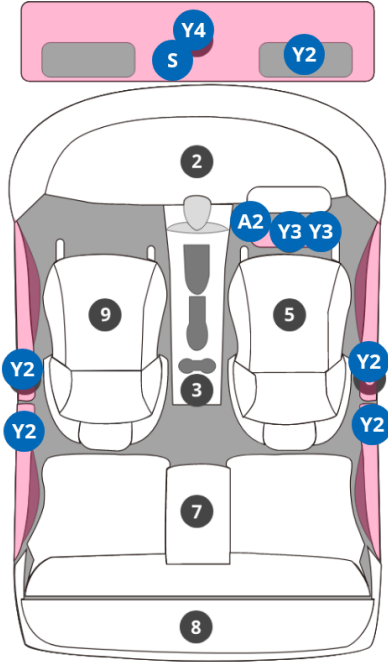
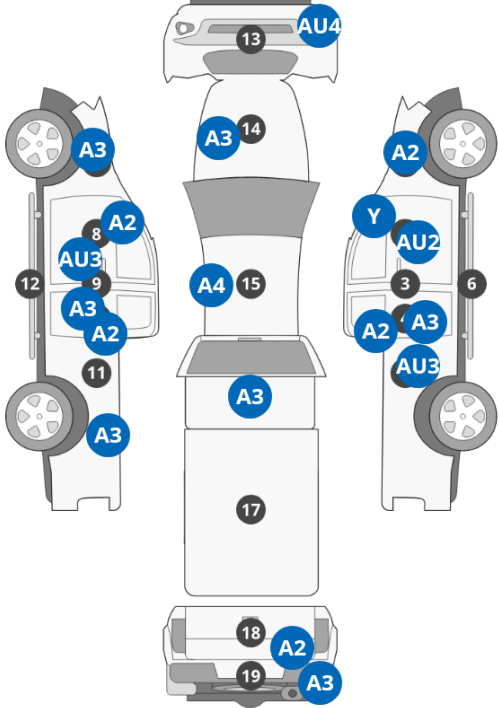
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	118	121	116
2	Boot Lid	110.6	101	126	105
3	Roof	117.0	111	110	125/122
4	Left Front Fender	122.6	132	115	121
5	Left Front Door	109.3	112	110	106
6	Center Panel Left				
7	Left Rear Door	101.8	105	100	101
8	Left Back Panel	101.9	102	107	97
9	Right Front Fender	112.0	112	106	118
10	Right Front Door	109.3	109	109	110
11	Center Panel Right				
12	Right Rear Door	101.6	98	99	108
13	Right Back Panel	107.0	102	109	110

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Small / (L) Rear Trim - Grime - Small / Mat Other - Grime - Medium / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / Overall Interior - Smell - Yes</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Corner Panel - Scratch - Small / (R) Side Gate - Scratch & Dent - Medium / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Side Gate - Scratch - Medium / (L) Rear Corner Panel - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Roof - Scratch - Large / Cab Back Panel - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (R) Mirror - Crack - Cracks</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Replace fuel filter indicated at the instrument panel. Rusted seat railings. Bad smell. Rear window automatic switch issue both sides. Master switch for rear windows not working. Without warranty booklet, jack and tools. With spare tire and seat cover. 1 key. With LTO plate.</p>