

General Information

Date & Time: 02, Feb, 2026 08:48

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	10,395
Registration No.	GBK8001	Chassis No.	PA1B18F35S4292993
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



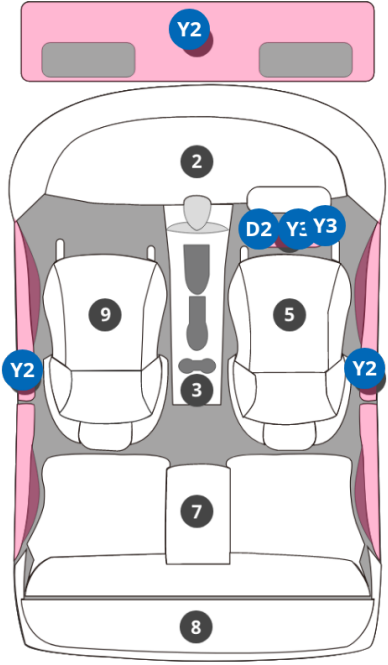
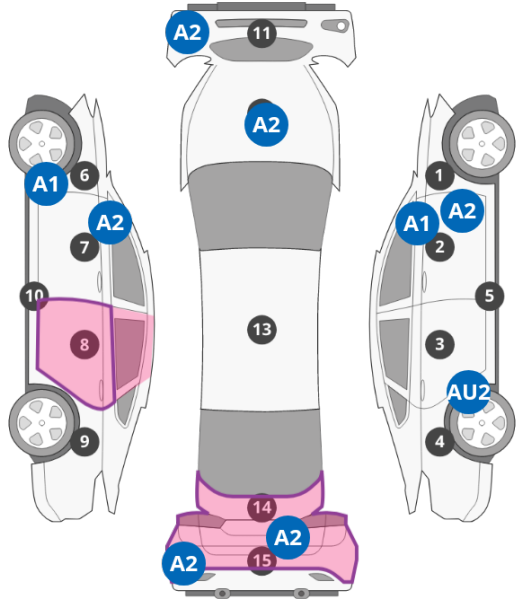
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	116	115	114
2	Boot Lid	222.6	201	280	187
3	Roof	108.0	110	105	113/104
4	Left Front Fender	102.4	99	103	105
5	Left Front Door	103.0	105	100	104
6	Center Panel Left				
7	Left Rear Door	112.6	113	116	109
8	Left Back Panel	116.3	119	114	116
9	Right Front Fender	104.6	104	100	110
10	Right Front Door	109.6	118	105	106
11	Center Panel Right				
12	Right Rear Door	113.3	108	110	122
13	Right Back Panel	105.6	105	101	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Mat Other - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>Trunk door repaired. With Warranty booklet, spare tire, jack and seat cover. Without tools. 3 keys. No LTO plate.</p>