

General Information

Date & Time: 30, Jan, 2026 10:40

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	8,920
Registration No.	GBK7726	Chassis No.	MHKAA1BC9SJ042569
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



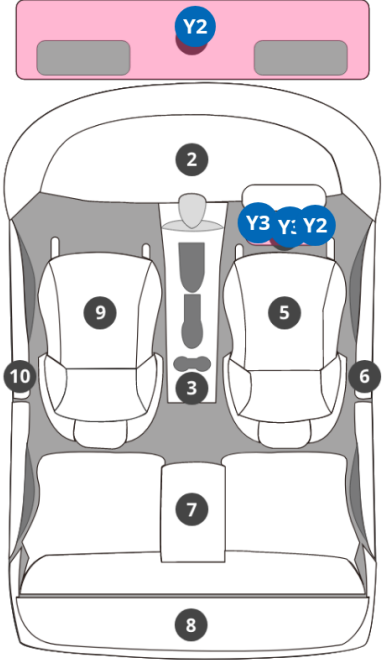
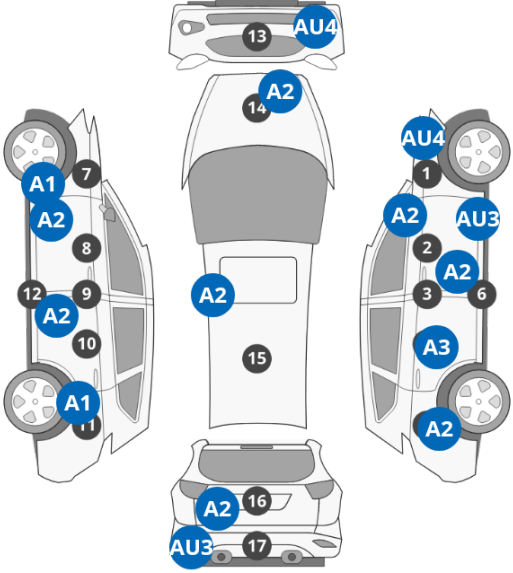
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.0	118	127	127
2	Boot Lid	113.0	116	111	112
3	Roof	104.0	108	103	104/101
4	Left Front Fender	101.6	104	103	98
5	Left Front Door	108.6	110	107	109
6	Center Panel Left				
7	Left Rear Door	106.6	112	102	106
8	Left Back Panel	101.5	104	103	98
9	Right Front Fender	99.0	97	99	102
10	Right Front Door	108.6	111	108	107
11	Center Panel Right				
12	Right Rear Door	109.6	112	107	110
13	Right Back Panel	106.0	101	107	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / Mat Other - Grime - Medium / (R) Front Floor Mat - Grime - Small</p>	<p>Remarks Bonnet, Headlight - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch - Small</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Gap at front bumper, front right door and rear bumper. Unusual sound when pressing brake pedal. Without warranty booklet and tools. With spare tire, jack and seat cover. 1 key. With LTO plate.</p>