

General Information

Date & Time: 03, Feb, 2026 15:16

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	4,586
Registration No.	GBJ6681	Chassis No.	MHKAA1BC7RJ034044
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



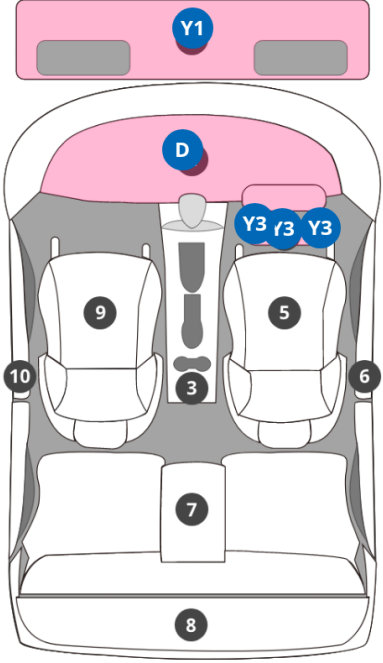
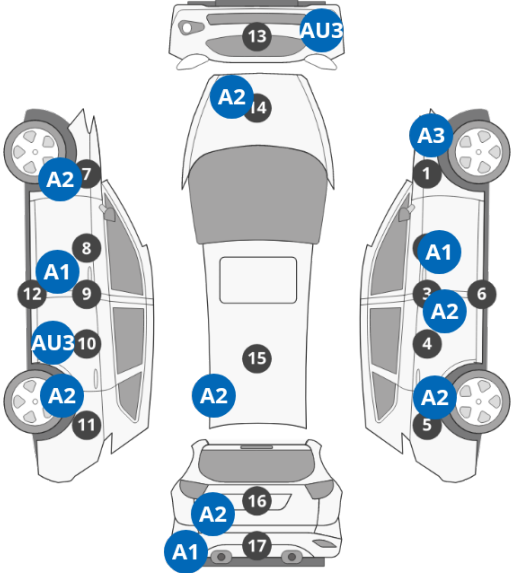
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.0	123	120	120
2	Boot Lid	104.3	106	104	103
3	Roof	101.2	103	104	100/98
4	Left Front Fender	100.8	102	102	99
5	Left Front Door	107.0	115	102	104
6	Center Panel Left				
7	Left Rear Door	104.0	106	101	105
8	Left Back Panel	100.7	100	104	99
9	Right Front Fender	97.9	94	99	101
10	Right Front Door	108.0	109	107	108
11	Center Panel Right				
12	Right Rear Door	106.3	106	104	109
13	Right Back Panel	100.4	101	98	102

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Mat Other - Grime - Medium / Ceiling - Grime - Minimal / (L) Front Floor Mat - Grime - Medium</p>	<p>Remarks (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With warranty booklet, spare tire, jack and seat cover. Without tools. 1 key. No LTO plate.</p>