

General Information

Date & Time: 02, Feb, 2026 13:28

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	16,632
Registration No.	GBJ1162	Chassis No.	PA1B18F31R4277319
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



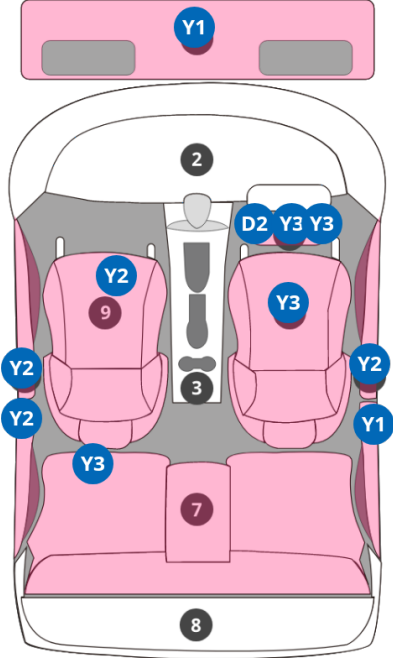
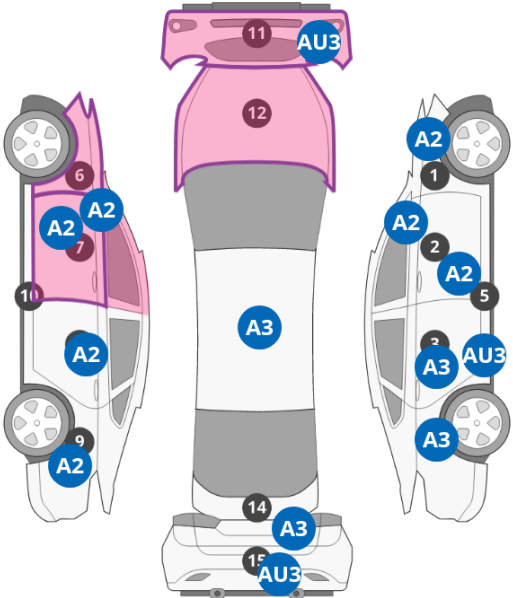
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	182.0	196	181	169
2	Boot Lid	102.6	100	99	109
3	Roof	102.1	103	106	99/101
4	Left Front Fender	105.6	111	105	101
5	Left Front Door	263.0	259	254	276
6	Center Panel Left				
7	Left Rear Door	112.3	116	114	107
8	Left Back Panel	112.3	120	109	108
9	Right Front Fender	106.3	100	113	106
10	Right Front Door	107.0	104	113	104
11	Center Panel Right				
12	Right Rear Door	103.6	101	105	105
13	Right Back Panel	107.6	98	107	118

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<p>Interior Evaluation : C</p>	<p>Exterior Evaluation : E</p>
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal / (L) Rear Trim - Grime - Small / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (R) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Medium</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / Overall Exterior - Re-Paint Uneven - Yes / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Medium</p>
<p>Frame Evaluation : D</p>	<p>Functional Evaluation : A</p>
<p>Remarks Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Left front door, left front fender and bonnet repaired. Without warranty booklet, seat cover and jack. Incomplete tools. With spare tire. 1 key. With LTO plate.</p>