

General Information

Date & Time: 10, Feb, 2026 06:47

Make	Suzuki	Model	XL7
YOM	2025	Odo Meter Reading	9,601
Registration No.	GBJ4095	Chassis No.	MHYNC32S6SJ104658
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



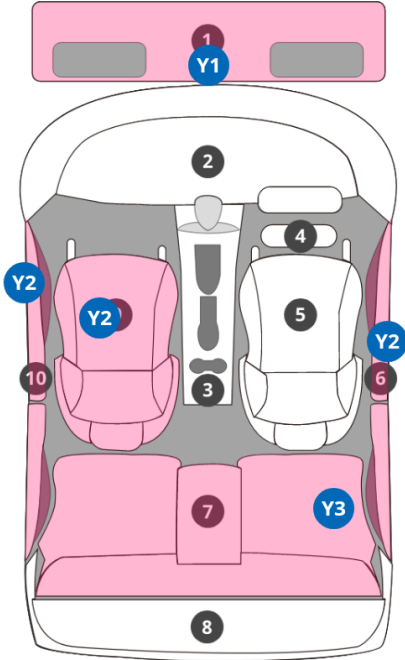
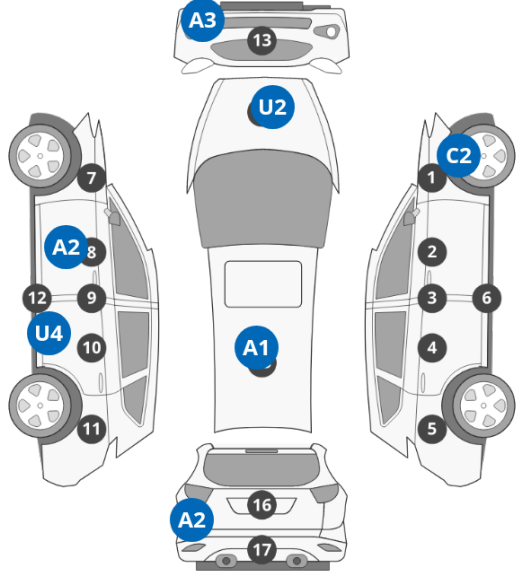
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	129.0	149	116	122
2	Boot Lid	110.6	94	144	94
3	Roof	122.2	103	73	103/210
4	Left Front Fender	119.6	115	117	127
5	Left Front Door	131.3	132	129	133
6	Center Panel Left				
7	Left Rear Door	130.3	138	129	124
8	Left Back Panel	113.3	125	115	100
9	Right Front Fender	123.0	124	123	122
10	Right Front Door	143.0	116	120	193
11	Center Panel Right				
12	Right Rear Door	124.3	115	125	133
13	Right Back Panel	105.0	102	112	101

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal</p>		<p>Remarks (R) Front Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Door, Molding - Dent - Large / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Dent - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Spare Key - Issue - Unexist</p>	

Inspector Notes
With LTO Plate. with Tools. without jack and seat cover. with warranty booklet. with spare tire.