

General Information

Date & Time: 31, Jan, 2025 10:47

Make	Mitsubishi	Model	Xpander
YOM	2021	Mileage	60,965
Registration No.	DAT8023	Chassis No.	MK2XRNC1WLN006014
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Orange		

Body / Panel Condition



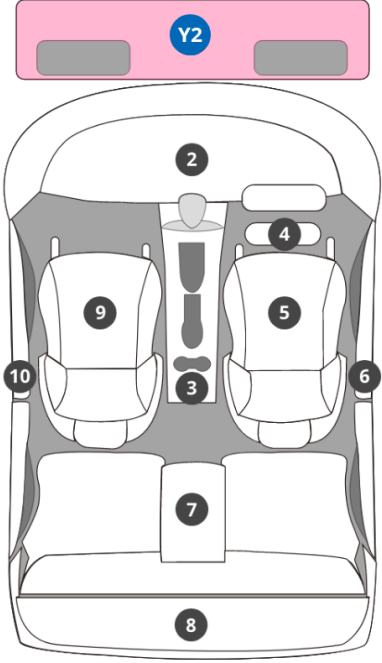
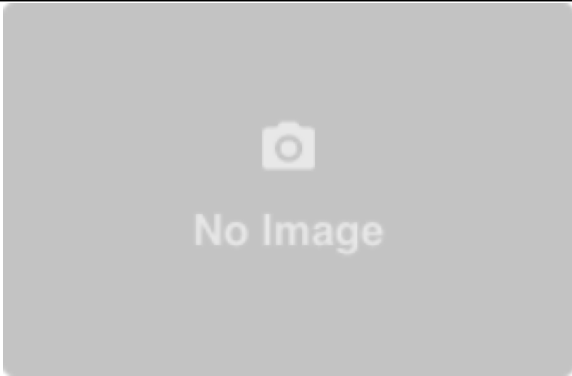
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.2	99	84	97
2	Boot Lid	133.6	134	131	136
3	Roof	102.3	113	98	101/98
4	Left Front Fender	90.3	88	92	91
5	Left Front Door	91.5	92	93	90
6	Center Panel Left				
7	Left Rear Door	91.1	90	91	92
8	Left Back Panel	127.3	125	130	127
9	Right Front Fender	87.7	87	87	90
10	Right Front Door	92.6	94	93	92
11	Center Panel Right				
12	Right Rear Door	86.0	86	87	86
13	Right Back Panel	94.2	90	93	100

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small	Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with spare tire, and warranty booklet. without jack and tools. with LTO plate.