

General Information

Date & Time: 30, Jan, 2026 06:35

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	8,743
Registration No.	FAT4347	Chassis No.	PA1B18F31S490223
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



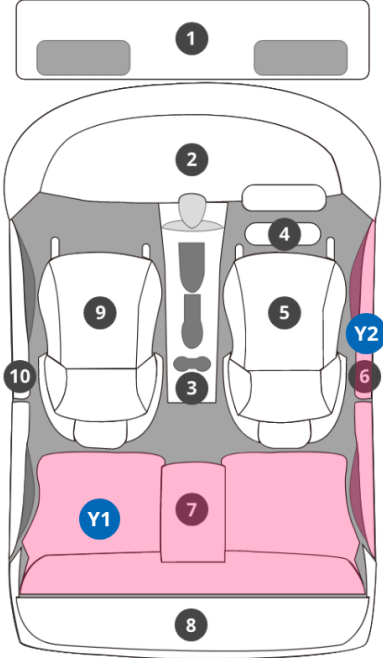
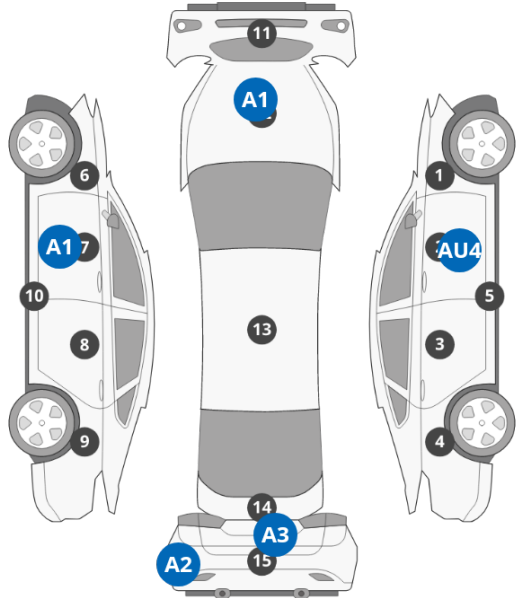
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.2	97	96	92
2	Boot Lid	103.3	112	104	94
3	Roof	93.5	101	91	97/85
4	Left Front Fender	128.1	186	101	97
5	Left Front Door	89.8	94	89	86
6	Center Panel Left				
7	Left Rear Door	94.3	95	94	94
8	Left Back Panel	100.5	92	117	93
9	Right Front Fender	105.5	121	103	93
10	Right Front Door	95.6	94	98	95
11	Center Panel Right				
12	Right Rear Door	93.5	91	92	98
13	Right Back Panel	94.0	93	96	93

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	A	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (R) Front Trim - Grime - Small / Rear Seat - Grime - Minimal</p>		<p>Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Spare Key - Issue - Unexist</p>	

Inspector Notes
With spare tire. with warranty booklet. no jack and tools. with seat cover. no spare key