

General Information

Date & Time: 29, Jan, 2026 16:05

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	66,332
Registration No.	NHM4503	Chassis No.	PA1B18F36P4236908
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



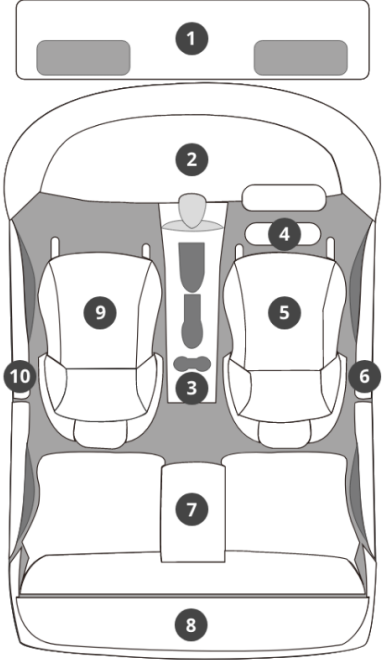
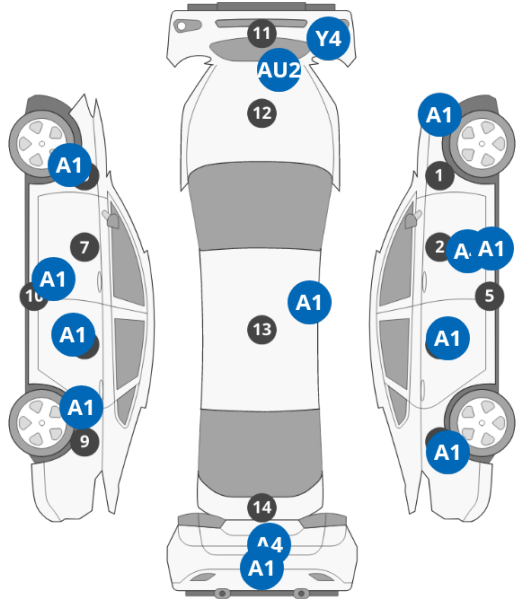
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	117	115	116
2	Boot Lid	119.0	128	112	117
3	Roof	102.3	105	98	101/105
4	Left Front Fender	103.0	103	101	105
5	Left Front Door	104.0	104	105	103
6	Center Panel Left				
7	Left Rear Door	102.9	109	102	98
8	Left Back Panel	107.6	112	106	105
9	Right Front Fender	117.6	122	115	116
10	Right Front Door	111.3	108	105	121
11	Center Panel Right				
12	Right Rear Door	108.6	104	106	116
13	Right Back Panel	111.0	102	106	125

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with warranty booklet, with spare tire, with jack and tools, 2keys, Crack headlight and moist,cover under hood missing