

General Information

Date & Time: 02, Feb, 2025 12:59

Make	Toyota	Model	Vios
YOM	2019	Mileage	95,014
Registration No.	EAB9955	Chassis No.	PA1B13F35J4073145
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



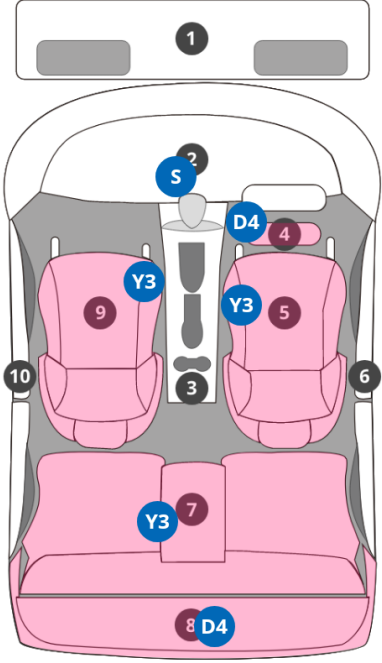
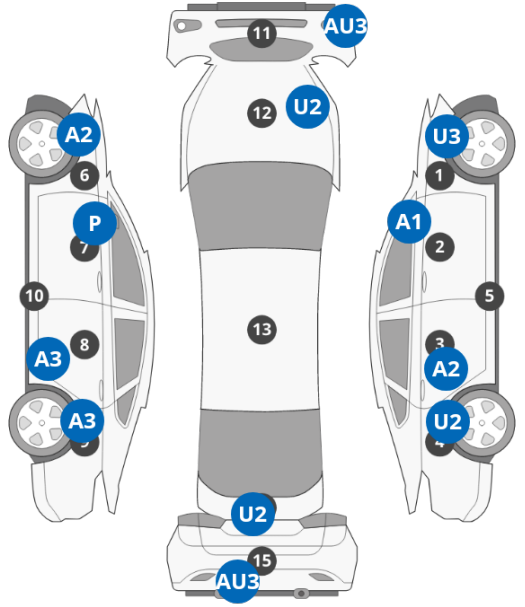
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.9	110	94	108
2	Boot Lid	229.6	270	199	220
3	Roof	101.5	95	89	123/99
4	Left Front Fender	95.5	95	93	98
5	Left Front Door	101.9	98	99	109
6	Center Panel Left				
7	Left Rear Door	130.3	138	127	126
8	Left Back Panel	100.8	112	102	88
9	Right Front Fender	275.3	119	547	160
10	Right Front Door	127.6	131	125	127
11	Center Panel Right				
12	Right Rear Door	134.3	131	135	137
13	Right Back Panel	289.0	165	166	536

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Large / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worked - Large / Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Dent - Small / (R) Front Fender, Molding - Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Small / (L) Mirror - Faded(Color, Gloss) - Yes
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ incomplete tools/ possible flooding/ no reverse camera/with LTO plate/ other interior trim has molds/with jack/ yellowing of right headlight