

General Information

Date & Time: 03, Feb, 2026 09:32

Make	Geely	Model	Coolray
YOM	2023	Odo Meter Reading	69,552
Registration No.	DBH2832	Chassis No.	LB37622Z1PX412990
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



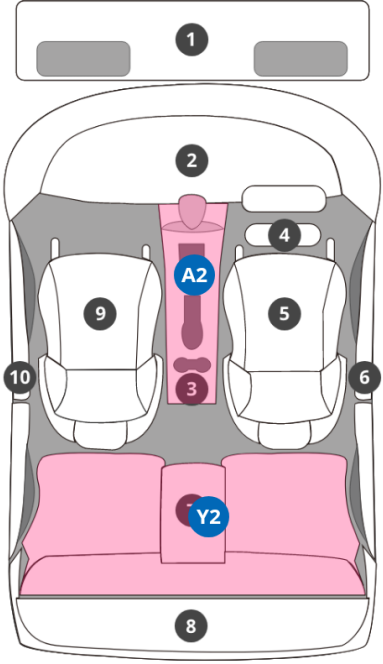
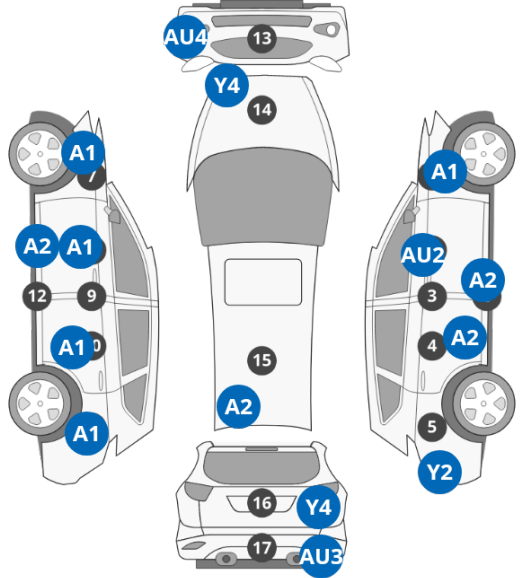
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	110	110	107
2	Boot Lid	119.3	130	106	122
3	Roof	163.0	163	162	165/162
4	Left Front Fender	112.6	115	111	112
5	Left Front Door	129.6	127	129	133
6	Center Panel Left				
7	Left Rear Door	114.3	127	115	101
8	Left Back Panel	102.7	111	99	98
9	Right Front Fender	118.0	109	127	118
10	Right Front Door	109.6	109	111	109
11	Center Panel Right				
12	Right Rear Door	119.6	112	115	132
13	Right Back Panel	118.3	107	121	127

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Small</p>	<p>Remarks Bonnet, Headlight - Crack, Gap - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Crack, Gap - Small / (L) Rear Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ no jack and tools/ head light issue/ tail light issue/ tail gate issue/ battery issue/ key fob issue/ with spare tire and LTO plate/</p>