

General Information

Date & Time: 01, Feb, 2025 14:42

Make	Toyota	Model	Vios
YOM	2021	Mileage	103,786
Registration No.	DAU1911	Chassis No.	PA1B18F39L4131841
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



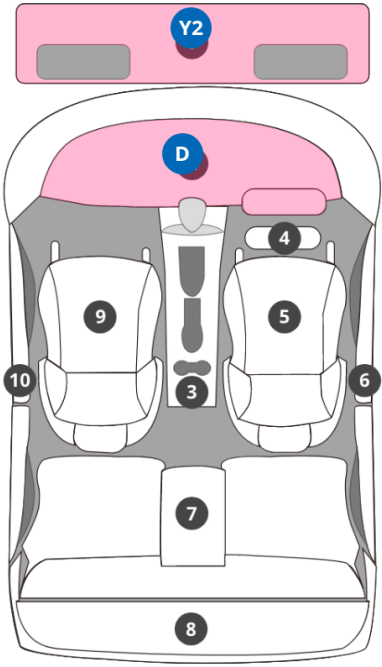
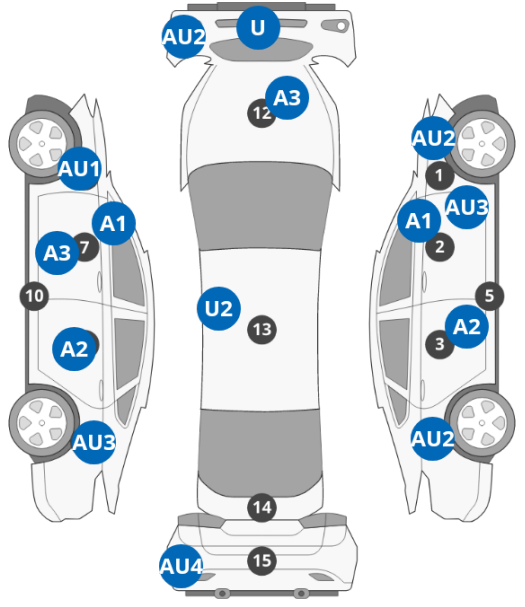
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.9	98	94	108
2	Boot Lid	96.3	93	95	101
3	Roof	92.8	96	89	93/93
4	Left Front Fender	85.9	91	85	82
5	Left Front Door	88.8	91	90	85
6	Center Panel Left				
7	Left Rear Door	89.3	91	88	89
8	Left Back Panel	100.6	105	99	98
9	Right Front Fender	69.3	73	64	71
10	Right Front Door	84.6	84	84	86
11	Center Panel Right				
12	Right Rear Door	87.2	86	87	89
13	Right Back Panel	93.6	94	91	96

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / Roof - Dent - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with spare tire, tools, jack. without warranty booklet. with LTO plate. with leather seats. with dashcam wire without the dash camera.