

General Information

Date & Time: 03, Feb, 2026 14:54

Make	GAC Motor	Model	GAC GS8
YOM	2019	Odo Meter Reading	92,099
Registration No.	NDA5454	Chassis No.	LMGJS1G55K1140624
CC	2.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



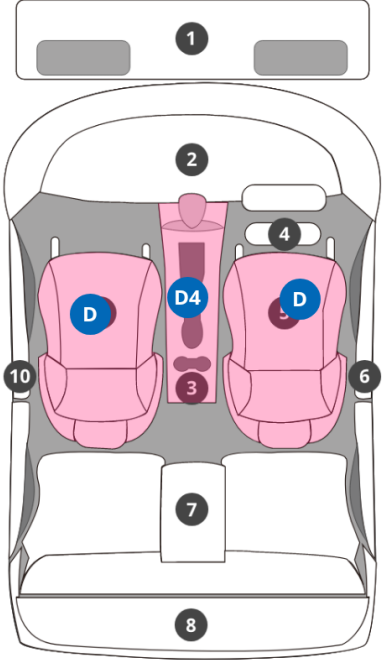
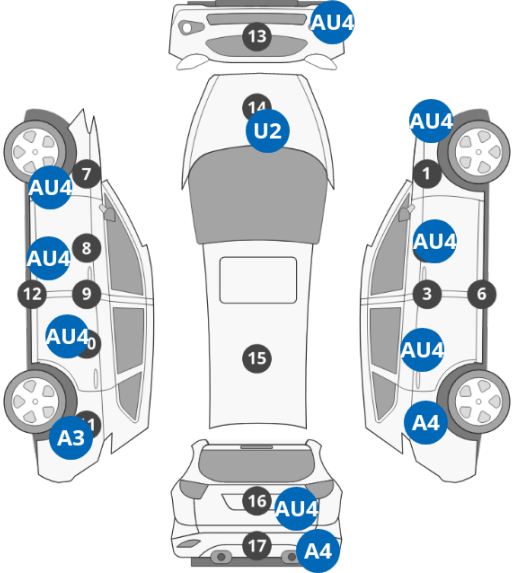
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	108	108	108
2	Boot Lid	103.5	113	91	107
3	Roof	112.2	108	111	120/110
4	Left Front Fender	117.6	109	122	122
5	Left Front Door	116.3	124	110	115
6	Center Panel Left				
7	Left Rear Door	115.0	115	117	113
8	Left Back Panel	113.6	123	115	103
9	Right Front Fender	117.0	119	110	122
10	Right Front Door	117.0	124	121	106
11	Center Panel Right				
12	Right Rear Door	113.3	110	114	116
13	Right Back Panel	106.3	101	100	118

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Console, Switchs, Vents - Worked - Large	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Dent - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
power window issue/ airbag warning lamp/ plate light issue/ signs of overheating/ signs of oil leak/ no warranty booklet/ with jack and sparetire/ incomplete tools/ with LTO plate/