

General Information

Date & Time: 06, Feb, 2026 15:25

Make	Toyota	Model	Fortuner
YOM	2020	Odo Meter Reading	25,756
Registration No.	NFX8395	Chassis No.	MHFJB8GS2L1580391
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



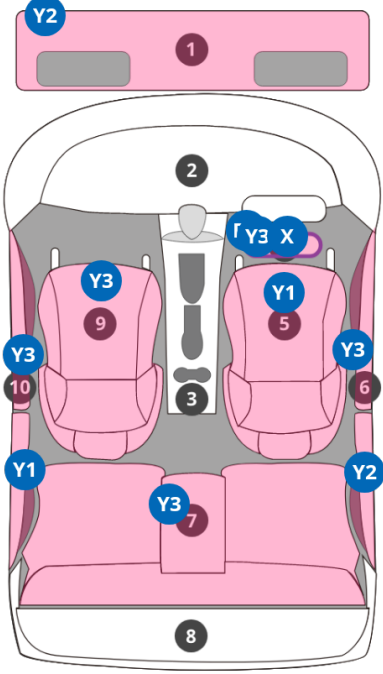
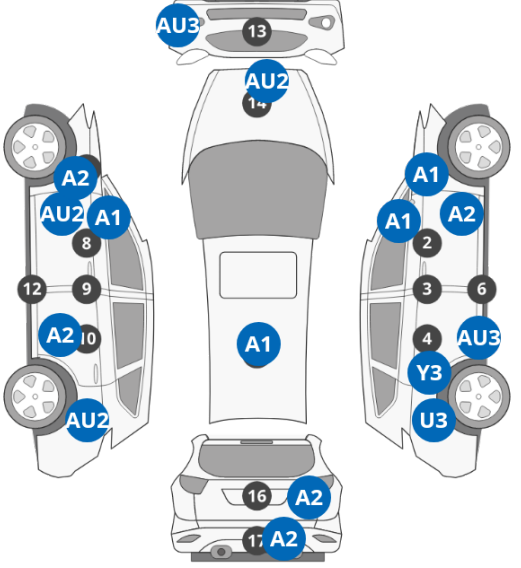
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	120	121	107
2	Boot Lid	77.5	78	77	78
3	Roof	124.0	124	140	126/106
4	Left Front Fender	115.6	112	114	121
5	Left Front Door	118.0	123	115	116
6	Center Panel Left				
7	Left Rear Door	100.0	104	99	98
8	Left Back Panel	114.0	116	107	119
9	Right Front Fender	296.0	364	332	192
10	Right Front Door	115.0	126	109	110
11	Center Panel Right				
12	Right Rear Door	287.3	566	147	149
13	Right Back Panel	176.6	196	149	185

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Minimal / Overall Interior - Worn as per age - Yes / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Medium / Mat Other - Missing - Yes / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Crack, Gap - Medium / (R) Rear Fender, Molding - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light and headlight, no VS form, HPG recovered, with possible HPG alarm</p>