

General Information

Date & Time: 03, Feb, 2026 17:54

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	26,695
Registration No.	DBT1492	Chassis No.	MHKAA1BC1RJ029972
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



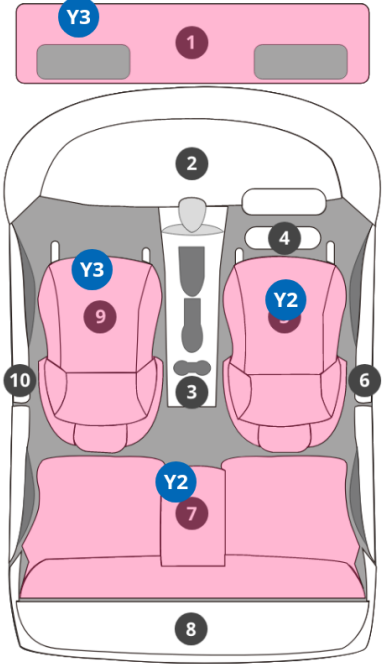
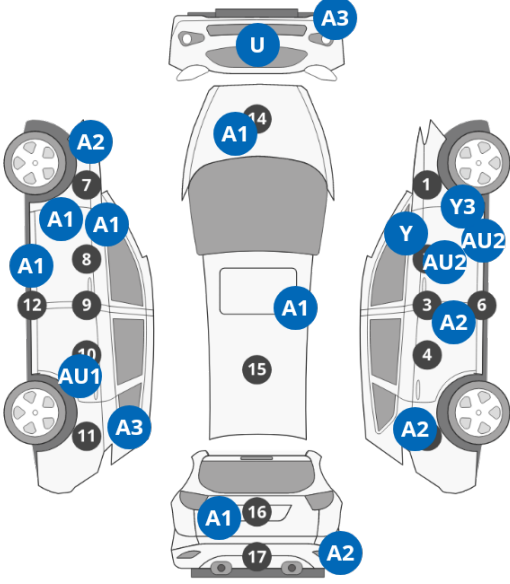
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	115	120	107
2	Boot Lid	86.9	84	85	93
3	Roof	115.9	84	89	88/203
4	Left Front Fender	101.3	105	103	96
5	Left Front Door	109.6	107	104	118
6	Center Panel Left				
7	Left Rear Door	99.2	100	104	94
8	Left Back Panel	95.6	84	100	103
9	Right Front Fender	100.6	107	100	95
10	Right Front Door	115.3	127	104	115
11	Center Panel Right				
12	Right Rear Door	100.1	91	101	108
13	Right Back Panel	96.8	105	99	87

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Medium / Rear Seat - Grime - Small	Remarks Roof - Repair Traces - Yes / (R) Mirror - Crack - Damaged / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet and jack, no tools, with spare tire, with LTO plate, scratches on tail light, right side mirror crack/damaged