

General Information

Date & Time: 04, Feb, 2026 05:07

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	48,060
Registration No.	NEY4257	Chassis No.	PA1B18F33R4255046
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



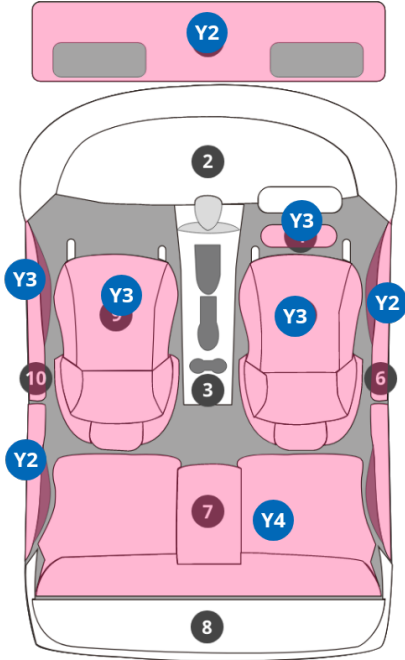
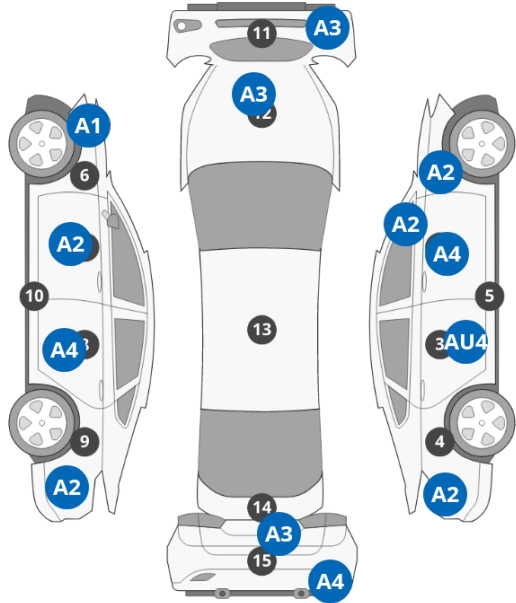
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.5	113	91	101
2	Boot Lid	92.7	91	90	98
3	Roof	89.6	92	92	77/97
4	Left Front Fender	91.7	94	88	93
5	Left Front Door	88.7	89	89	89
6	Center Panel Left				
7	Left Rear Door	97.1	108	95	88
8	Left Back Panel	96.1	100	94	95
9	Right Front Fender	97.5	91	104	98
10	Right Front Door	99.5	113	91	94
11	Center Panel Right				
12	Right Rear Door	142.0	135	138	153
13	Right Back Panel	147.6	145	146	152

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small / (L) Front Floor Mat - Grime - Medium</p>	<p>Remarks (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Head Light, High Beam - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 2 spare key/dome light issue/No seat cover/with jack No tools/with reverse camera/No warranty booklets/</p>