

General Information

Date & Time: 03, Feb, 2026 17:51

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	27,033
Registration No.	NFP7518	Chassis No.	MHFAA1BY4N0006826
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



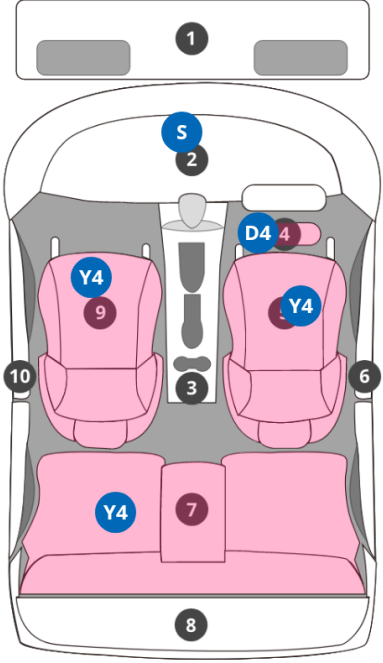
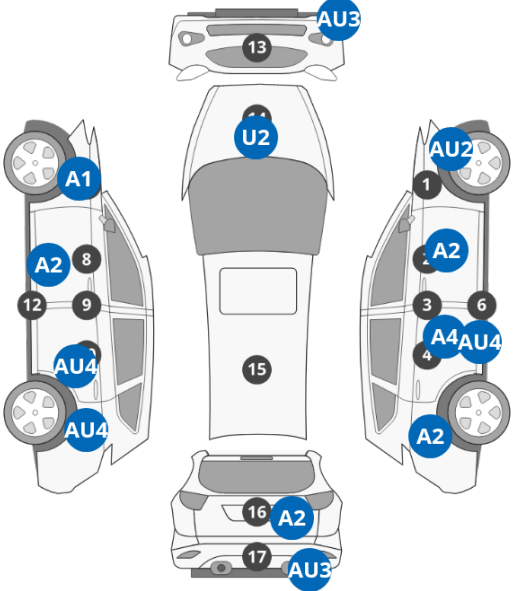
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.2	96	106	111
2	Boot Lid	112.0	110	127	99
3	Roof	113.0	117	115	115/105
4	Left Front Fender	99.3	93	97	108
5	Left Front Door	105.6	100	100	117
6	Center Panel Left				
7	Left Rear Door	107.6	110	103	110
8	Left Back Panel	105.1	116	102	98
9	Right Front Fender	106.3	113	108	98
10	Right Front Door	106.0	106	107	105
11	Center Panel Right				
12	Right Rear Door	112.0	115	107	114
13	Right Back Panel	100.5	102	84	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Large</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no tools/ possible flooding/ with jack and spare tire/ with LTO plate and warranty booklet/</p>