

General Information

Date & Time: 03, Feb, 2026 18:57

Make	Toyota	Model	Fortuner
YOM	2024	Odo Meter Reading	46,773
Registration No.	NFR1906	Chassis No.	MHFAA3GS0P0747767
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Black		

Body / Panel Condition



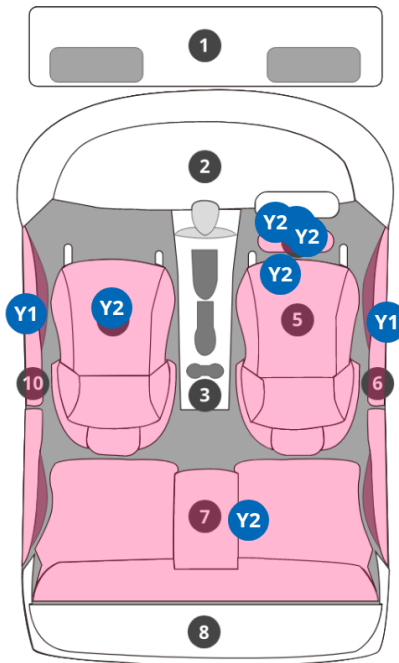
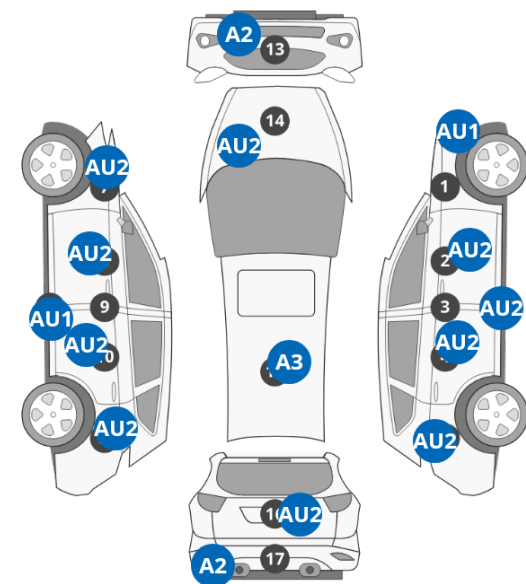
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.3	131	124	118
2	Boot Lid	114.0	106	133	103
3	Roof	123.0	118	155	107/112
4	Left Front Fender	120.3	125	114	122
5	Left Front Door	120.3	127	116	118
6	Center Panel Left				
7	Left Rear Door	114.6	116	111	117
8	Left Back Panel	128.0	130	124	130
9	Right Front Fender	123.3	125	117	128
10	Right Front Door	123.6	121	114	136
11	Center Panel Right				
12	Right Rear Door	113.0	112	110	117
13	Right Back Panel	128.0	130	121	133

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small</p>	<p>Remarks (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with tools and jack, with reverse camera, with manual and warranty booklet, scratches on taillight and headlight, no spare key, issue on driver side switch on right passenger side window.</p>