

General Information

Date & Time: 03, Feb, 2026 19:00

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	16,876
Registration No.	NHG9214	Chassis No.	MR0JB8DD1P3221577
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Silver		

Body / Panel Condition



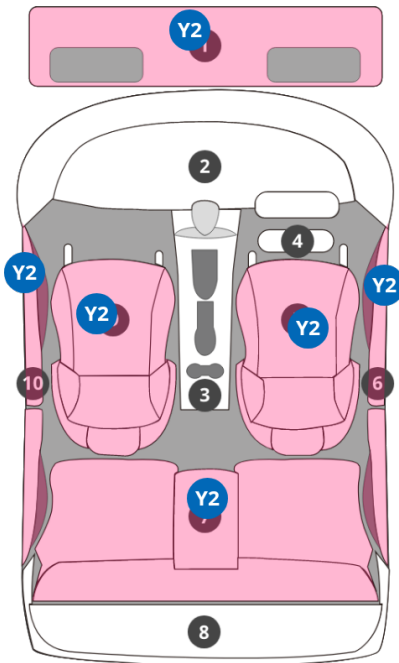
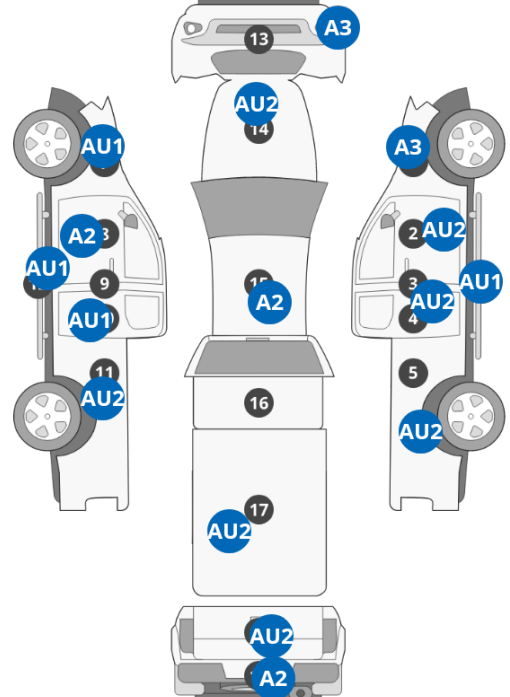
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	135.0	130	142	133
2	Boot Lid	102.6	100	111	97
3	Roof	124.7	145	115	125/114
4	Left Front Fender	127.3	143	116	123
5	Left Front Door	121.0	119	117	127
6	Center Panel Left	126.0	113	136	129
7	Left Rear Door	117.0	124	112	115
8	Left Back Panel	123.0	142	114	113
9	Right Front Fender	118.6	116	116	124
10	Right Front Door	113.3	115	113	112
11	Center Panel Right	125.3	120	127	129
12	Right Rear Door	119.6	124	112	123
13	Right Back Panel	125.3	120	142	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Side Gate - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / Cargo Bed Floor - Scratch & Dent - Small / (R) Side Gate - Scratch & Dent - Small / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with reverse camera, scratches on taillight and headlight, no warranty and manual booklet, no spare key, no tools and jack.</p>