

General Information

Date & Time: 03, Feb, 2026 15:28

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	16,098
Registration No.	NKL4353	Chassis No.	PA1B18F32R4281136
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



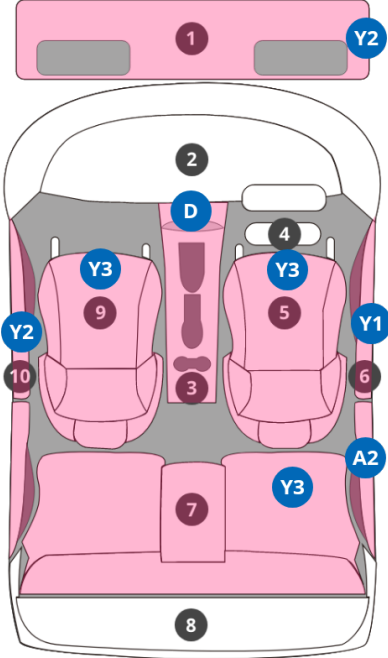
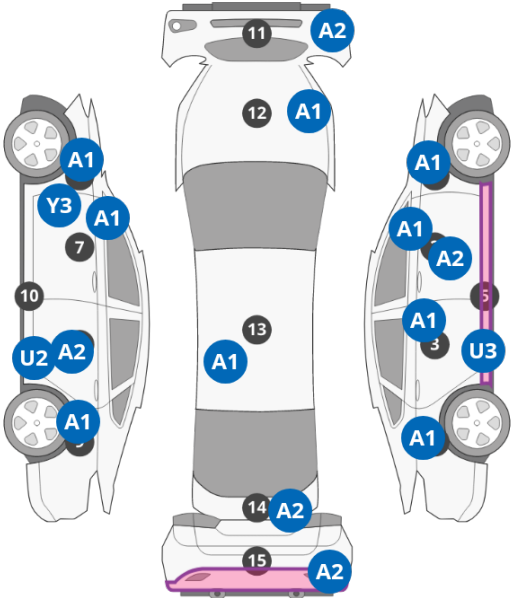
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.7	119	99	111
2	Boot Lid	112.3	110	109	118
3	Roof	102.7	101	106	102/102
4	Left Front Fender	267.3	156	264	382
5	Left Front Door	103.0	101	100	108
6	Center Panel Left				
7	Left Rear Door	110.0	114	109	107
8	Left Back Panel	250.3	221	249	281
9	Right Front Fender	103.6	100	102	109
10	Right Front Door	101.3	101	101	102
11	Center Panel Right				
12	Right Rear Door	103.6	103	103	105
13	Right Back Panel	170.3	171	171	169

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Minimal / (R) Rear Trim - Cut, Crack - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Ceiling - Grime - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Front Door, Molding - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, no LTO plate, scratches on tail light</p>