

## General Information

Date & Time: 04, Feb, 2026 12:11

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2010	<b>Odo Meter Reading</b>	268,767
<b>Registration No.</b>	PFQ358	<b>Chassis No.</b>	NCP938008339
<b>CC</b>	1.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Brown		

## Body / Panel Condition



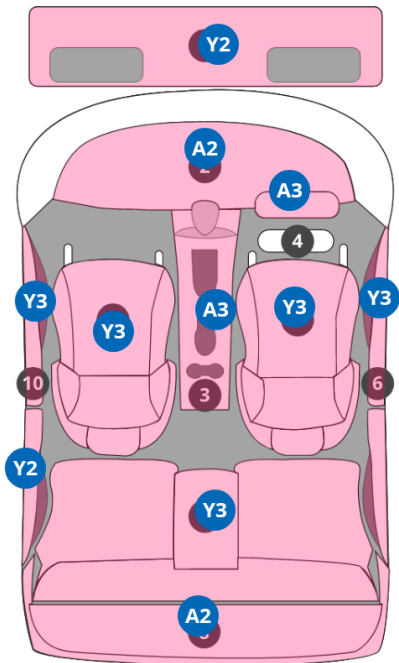
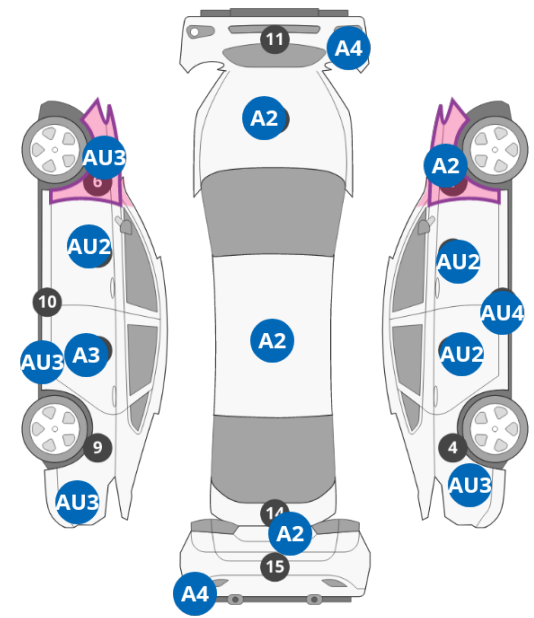
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.1	107	96	92
2	Boot Lid	84.6	92	73	88
3	Roof	87.1	93	99	80/77
4	Left Front Fender	155.3	186	133	147
5	Left Front Door	121.3	124	119	121
6	Center Panel Left				
7	Left Rear Door	120.6	127	115	120
8	Left Back Panel	109.0	120	103	104
9	Right Front Fender	277.0	217	381	233
10	Right Front Door	119.6	118	121	120
11	Center Panel Right				
12	Right Rear Door	108.3	105	113	107
13	Right Back Panel	109.0	103	110	114

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Medium / Ceiling - Grime - Small	<b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Roof - Scratch - Small
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
with LTO plate/with spare tire/No spare key/No reverse camera/plate light issue/with warranty booklet/dome light issue/assist handle bar missing/trunk room issue/Audio radio issue/ear seat issue/No seat cover /all around vehicle faded color/unusual sound engine/door lock issue/seatbelts issue/interior dirty