

## General Information

Date & Time: 10, Feb, 2026 10:33

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2012	<b>Odo Meter Reading</b>	158,216
<b>Registration No.</b>	TIE680	<b>Chassis No.</b>	NCP929046508
<b>CC</b>	1.3	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Brown		

## Body / Panel Condition



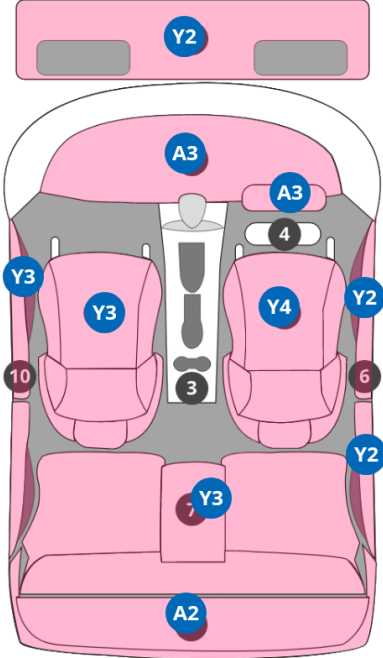
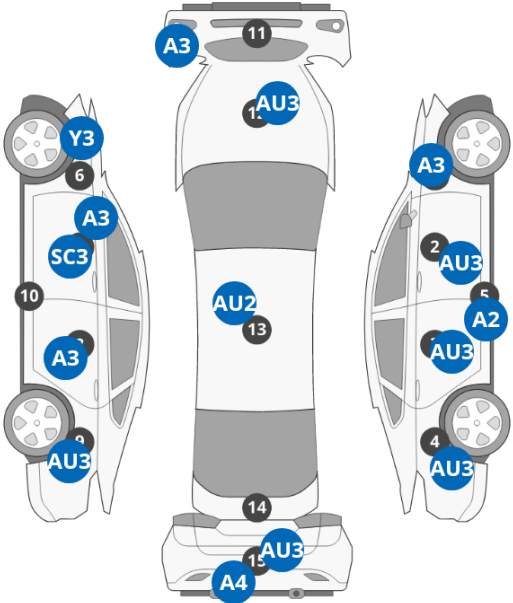
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.8	113	98	107
2	Boot Lid	96.6	96	100	94
3	Roof	100.4	100	99	100/103
4	Left Front Fender	98.8	111	87	99
5	Left Front Door	99.1	103	97	98
6	Center Panel Left				
7	Left Rear Door	112.3	102	108	127
8	Left Back Panel	473.6	436	516	469
9	Right Front Fender	253.3	111	143	506
10	Right Front Door	201.6	271	144	190
11	Center Panel Right				
12	Right Rear Door	275.6	196	432	199
13	Right Back Panel	126.8	95	96	190

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Crack, Gap - Medium / (L) Mirror - Scratch - Medium / (L) Front Door, Molding - Rust, Corrosion - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Medium / Roof - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>E</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Seat Belts - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with 2 key/No jack and tools/dome light issue/plate light issue/speaker issue/head units issue/audio radio issue/aircon issue/engine noise vibration/No warranty booklets/reverse camera not working/left side tail light cover crack/door lock issue/aircon issue/right grab handle missing/No seat cover</p>