

## General Information

Date & Time: 23, Feb, 2026 08:53

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2011	<b>Odo Meter Reading</b>	164,688
<b>Registration No.</b>	VFF105 - NON-MOVING	<b>Chassis No.</b>	NCP929038665
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



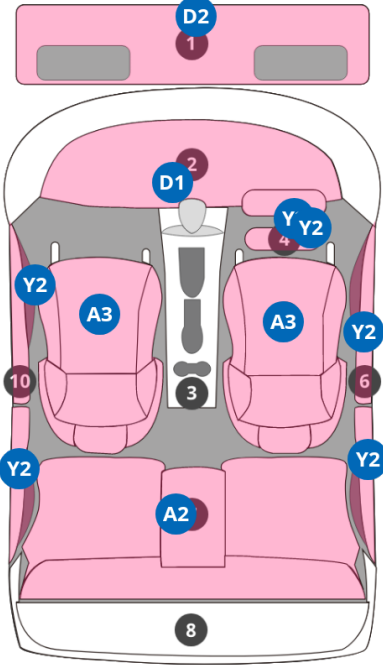
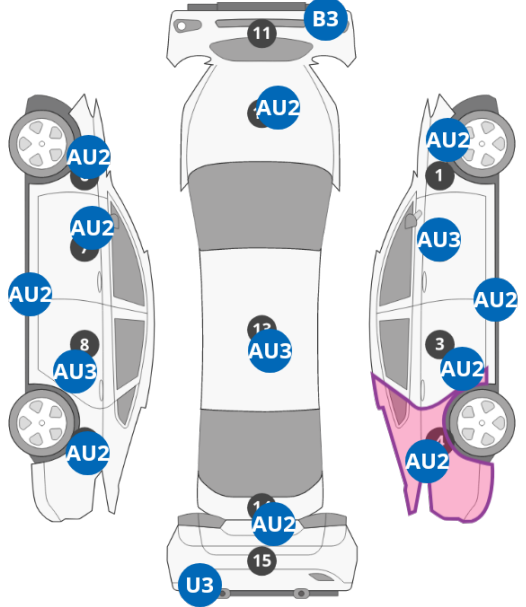
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	103	102	112
2	Boot Lid	116.3	126	112	111
3	Roof	126.7	128	163	108/108
4	Left Front Fender	67.6	77	74	53
5	Left Front Door	134.6	142	117	145
6	Center Panel Left				
7	Left Rear Door	128.3	144	128	113
8	Left Back Panel	117.0	125	113	113
9	Right Front Fender	116.0	118	112	118
10	Right Front Door	116.3	116	117	116
11	Center Panel Right				
12	Right Rear Door	141.3	135	141	148
13	Right Back Panel	118.6	120	120	116

## Overall Evaluation :

D

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (L) Front Seat - Cut, Crack - Medium / (R) Front Seat - Cut, Crack - Medium / Rear Seat - Cut, Crack - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / Ceiling - Crinkle - Small / Dashboard - Worked - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small	<b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Modified - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
<b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	<b>Remarks</b> Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
non moving unit, with LTO plate, no spare key, no spare tire, no reverse camera, scratches on taillight and headlight, issue foglamps, no spare key, flat tire.